. . .

0f 4567-01

ORNL/RASA-87/33

# oml

1.10

Ţ

T

## OAK RIDGE NATIONAL LABORATORY

MARTIN MARIETTA

# RESULTS OF THE RADIOLOGICAL SURVEY AT 5 HANCOCK STREET, LODI, NEW JERSEY (LJ029)

W. D. Cottrell L. M. Floyd M. W. Francis J. O. Mynatt

OPERATED BY MARTIN MARIETTA ENERGY SYSTEMS, INC. FOR THE UNITED STATES DEPARTMENT OF ENERGY

C

This report has been reproduced directly from the best available copy.

Available to DOE and DOE contractors from the Office of Scientific and Technical Information, P.O. Box 62, Oak Ridge, TN 37831; prices available from (615) 576-8401, FTS 626-8401.

Available to the public from the National Technical Information Service, U.S. Department of Commerce, 5285 Port Royal Rd., Springfield, VA 22181. NTIS price codes-Printed Copy: A03 Microfliche A01

This report was prepared as an account of work sponsored by an agency of the United States Government. Neither the United States Government nor any agency thereof, nor any of their employees, makes any warranty, express of implied, or assumes any legal liability or responsibility for the accuracy, completeness, or usefulness of any information, apparetus, product, or process disclosed, or represents that its use would not infringe privately owned rights Reference herein to any specific commercial product, process, or service by trade name, trademark, manufacturer, or otherwise, does not necessarily constitute or imply its endorsement, recommendation, or favoring by the United States Government or any agency thereof. The views and opinions of authors expressed herein do not necessarily state or reflect those of the United States Government or any agency thereof.

## 06 4 37

#### OKNL/RASA-87/33

١

#### HEALTH AND SAFETY RESEARCH DIVISION

Waste Management Research and Development Programs (Activity No. AH 10 05 00 0; NEAH001)

Ĵ

#### RESULTS OF THE RADIOLOGICAL SURVEY AT 5 HANCOCK STREET, LODL, NEW JERSEY (LJ029)

W. D. Cottrell, L. M. Floyd, M. W. Francis, and J. O. Mynatt

Date Published - September 1989

**Investigation** Team

R. E. Swaja - Measurement Applications and Development Manager W. D. Cottrell - FUSRAP Project Director R. W. Doane<sup>\*</sup> - Field Survey Supervisor

Survey Team Members

A. C. Butler<sup>\*</sup> C. A. Muhr B. S. Ellis<sup>\*</sup> E. M. Pilz D. W. Greene W. H. Shinpaugh<sup>†</sup> R. A. Mathis J. K. Williams W. Winton

\*Former Employees of Martin Marietta Energy Systems, Inc. \*Stone Associates

Work performed by the MEASUREMENT APPLICATIONS AND DEVELOPMENT GROUP

> Prepared by the OAK RIDGE NATIONAL LABORATORY Oak Ridge, Transmos 37831-6285 operated by MARTIN MARIETTA ENERGY SYSTEMS, INC. for the U.S. DEPARTMENT OF ENERGY under Construct No. DE-AC05-840R21400

# 06 45 57

## CONTENTS

r. C

LIST OF FIGURES	¥
LIST OF TABLES	rii
ACKNOWLEDGMENTS	ix
ABSTRACT	xi
INTRODUCTION	1
SURVEY METHODS	2
SURVEY RESULTS	2
Surface Gamma Radiation Levels Systematic and Biased Soil Samples Auger Soil Samples	3
SIGNIFICANCE OF FINDINGS	4
REFERENCES	4

06 15 6

١

# LIST OF FIGURES

\_\_\_\_\_

1

1

Ì

. **.** . .

1	Gamma radiation levels (µR/h) measured on the surface at 5 Hancock Street, Lodi, New Jersey (LJ029)	5
2	Diagram showing locations of soil samples taken at 5 Hancock Street, Lodi, New Jersey (LJ029)	6
3	Gamma profile for auger hole 1 (LJ029A1) at 5 Hancock Street, Lodi, New Jersey	7
4	Gamma profile for auger hole 2 (LJ029A2) at 5 Hancock Street, Lodi, New Jersey	8
5	Gamma profile for auger hole 3 (LJ029A3) at 5 Hancock Street, Lodi, New Jersey	ò
6	Gamma profile for suger hole 4 (LJ029A4) at 5 Hancock Street, Lodi, New Jersey	10

# LIST OF TABLES

ľ

Ì

П

5

L

Ľ

5

ľ.

Ì

1	Applicable guidelines for protection against radiation	11
2	Background radiation levels for the northern New Jersey area	11
3	Concentrations of radionuclides in soil at 5 Hancock Street, Lodi, New Jersey (LJ029)	12

# 06 45 97

#### ACKNOWLEDGMENTS

Research for this project was sponsored by the Division of Facility and Site Decommissioning Projects. U.S. Department of Energy, under Contract No. DE-AC05-84OR21400 with Martin Marietta Energy Systems, Inc. The authors wish to acknowledge the support of J. E. Baublitz, Acting Director, Office of Remedial Action and Waste Technology; J. J. Fiore, Director, Division of Facility and Site Decommissioning Projects; and members of their staffs. The authors also appreciate the contributions of J. L. Rich, S. W. Hawthorne, B. C. Littleton, and L. J. Jeffers of the Publications Division; M. S. Uziel of the Environmental Information Systems Group; D. A. Roberts and T. R. Stewart of the Measurement Applications and Development Group; A. C. Butler and B. S. Ellis former employees of Martin Marietta Energy Systems, Inc.; and W. H. Shinpaugh of Don Stone Associates for participation in the collection, analyses, editing, and reporting of data for this survey.

#### ABSTRACT

Maywood Chemical Works (MCW) of Maywood, New Jersey, generated process wastes and residues associated with the production and refining of thorium and thorium compounds from monazite ores from 1916 to 1956. MCW supplied rare earth metals and thorium compounds to the Atomic Energy Commission and various other government agencies from the late 1940s to the mid-1950s. Area residents used the sandlike waste from this thorium extraction process mixed with tea and cocoa leaves as mulch in their yards. Some of these contaminated wastes were also eroded from the site into Lodi Brook. At the request of the U.S. Department of Energy (DOE), a group from Oak Ridge National Laboratory conducts investigative radiological surveys of properties in the vicinity of MCW to determine whether a property is contaminated with radioactive residues, principally <sup>220</sup>Th, derived from the MCW site. The survey typically includes direct measurement of gamma radiation levels and soil sampling for radionuclide analyses. The survey of this site, 5 Hancock Street, Lodi, New Jersey (LJ029), was conducted during 1985 and 1986.

Results of the survey demonstrated radionuclide concentrations in excess of the DOE Formerly Utilized Sites Remedial Action Program criteria. The radionuclide distributions are typical of the type of material originating from the MCW site.

06 4 5 6

#### RESULTS OF THE RADIOLOGICAL SURVEY AT 5 HANCOCK STREET, LODI, NEW JERSEY (LJ029)\*

での調査部件の法で

#### INTRODUCTION

From 1916 to 1956, process wastes and residues associated with the production and refining of thorium and thorium compounds from monazite ores were generated by the Maywood Chemical Works (MCW), Maywood, New Jersey. During the latter part of this period, MCW supplied rare earth metals and thorium compounds to various government agencies. In the 1940s and 1950s, MCW produced thorium and lithium, under contract, for the Atomic Energy Commission (AEC). These activities ceased in 1956, and, approximately three years later, the 30-acre real estate was purchased by the Stepan Company. The property is located at 100 Hunter Avenue in a highly developed area in Maywood and Rochelle Park, Bergen County, New Jersey.

During the early years of operation, MCW stored wastes and residues in lowlying areas west of the processing facilities. In the early 1930s, these areas were separated from the rest of the property by the construction of New Jersey State Highway 17. The Stepan property, the interim storage facility, and several vicinity properties have been designated for remedial action by the U.S. Department of Energy (DOE).

The waste produced by the thorium extraction process was a sandlike material containing residual amounts of thorium and its decay products, with smaller quantities of uranium and its decay products. During the years 1928 and 1944 to 1946, area residents used these process wastes mixed with tea and cocoa leaves as mulch in their lawns and gardens. In addition, some of the contaminated wastes were apparently eroded from the site into Lodi Brook and carried downstream.

Lodi Brook is a small stream flowing south from Maywood with its headwaters near the Stepan waste storage site, Approximately 150 ft after passing under State Route 17, the stream has been diverted underground through concrete or steel culverts until it merges with the Saddle River in Lodi, New Jersey. Only a small section near Interstate 80 remains uncovered. From the 1940s to the 1970s when the stream was being diverted underground, its course was altered several times. Some of these changes resulted in the movement of contaminated soil to the surface of a few properties, where it is still in evidence. In other instances, the contaminated soil was covered over or mixed with clean fill, leaving no immediate evi-

The survey was performed by members of the Measurement Applications and Development Group of the Health and Safety Research Division at Oak Ridge National Laboratory under U.S. DOE contract DE-AC05-840R21400.

dence on the surface. Therefore, properties in question may be drilled in scarch of former streambed material, even in the absence of surface contamination.

As a result of the Energy and Water Appropriations Act of Fiscal Year 1984, the property discussed in this report and properties in its vicinity contaminated with residues from the former MCW were included as a decontamination research and development project under the DOE Formerly Utilized Sites Remedial Action Program. As part of this project, DOE is conducting radiological surveys in the vicinity of the site to identify properties contaminated with residues derived from the MCW. The principal radionuclide of concern is thorium-232. The radiological surveys discussed in this report are part of that effort and were conducted, at the request of DOE, by members of the Measurement Applications and Development Group of the Oak Ridge National Laboratory.

A radiological survey of the private, residential property at 5 Hancock Street, Lodi, New Jersey, was conducted during 1985 and 1986. The survey and sampling of the ground surface was carried out on October 19, 1985, and the follow-up subsurface investigation was performed on September 18, 1986.

#### SURVEY METHODS

The radiological survey of the property included: (1) a gamma scan of the entire property outdoors, (2) collection of surface and subsurface soil samples, and (3) gamma profiles of auger holes. No indoor survey measurements were performed.

Using a portable gamma scintillation meter, ranges of measurements were recorded for areas of the property surface. If the gamma exposure rates were elevated, a biased soil sample was taken at the point showing the highest gamma radiation level. Systematic soil samples were taken at various locations on the property, irrespective of gamma radiation levels. These survey methods followed the plan outlined in Reference 1.

To define the extent of possible subsurface soil contamination, the auger holes were drilled to depths of approximately 2.7 m. A plastic pipe was placed in each hole, and a NaI scintillation probe was lowered inside the pipe. The probe was encased in a lead shield with a horizontal row of collimating slits on the side. This collimation allows measurement of gamma radiation intensities resulting from contamination within small fractions of the hole depth. Measurements were usually made at 15- or 30-cm intervals. If the gamma readings in the hole were elevated, a soil sample was scraped from the wall of the auger hole at the point showing the highest gamma radiation level. The auger hole loggings were used to select locations where further soil sampling would be useful. A split-spoon sampler was used to collect subsurface samples at known depths. In some auger holes, a combination of split-spoon sampling and side-wall scraping was used to collect samples. A comprehensive description of the survey methods and instrumentation has been presented in another report.<sup>2</sup>

#### SURVEY RESULTS

Applicable federal guidelines are summarized in Table 1.<sup>3</sup> The normal background radiation levels for the northern New Jersey area are presented in Table 2.<sup>4.5</sup> These data

are provided for comparison with survey results presented in this section. All direct we urement results presented in this report are gloss readings; background radiation where not been subtracted. Similarly, background concentrations have not been subtracted from radionuclide concentrations measured in environmental samples.

#### Serface Gamma Radiation Levels

Gamma radiation levels measured during a gamma scan of the surface of the property are given in Fig. 1. Gamma exposure rates over the major portion of the property rate from 6-13  $\mu$ R/h. One small area near the pool measured 14  $\mu$ R/h; this area is indicating Fig. 1.

#### Systematic and Biased Soil Samples

Systematic and biased soil samples were taken from various locations on the profor radionuclide analyses. Locations of the systematic (S) and biased (B) samples shown in Fig. 2, with results of laboratory analyses provided in Table 3. Concentraof uranium, radium, and thorium in the biased samples were above background levelthe northern New Jersey area (Table 2) but were below the guideline values (Table The radionuclide values for B1A-D, though below DOE criteria, continue to rise depth.

#### Auger Scil Samples

Varying thicknesses of subsurface soil were sampled from depths of 30 to 185 cm auger (A) holes which were drilled at 4 separate locations indicated in Fig. 2. The reof analyses of these samples are given in Table 3. Concentrations of <sup>226</sup>Ra and <sup>232</sup>To soil samples from all auger holes ranged from 0.62 to 2.1 and 0.77 to 19 pCi/g, retively. Radionuclide concentrations in sample A4C were above DOE criteria (Table 1) thorium (19 pCi/g); all other concentrations were below guidelines.


Gamma logging was performed in each of the 4 auger holes to characterize further define the extent of possible contamination. The logging technique used here in radionuclide specific. However, logging data, in conjunction with soil analyses data, in be used to estimate regions of elevated radionuclide concentrations in auger holes compared with background levels for the area. Following a comparison of these data, appears that any shielded scintillator readings of 1000 cpm or greater generally indice the presence of elevated concentrations of <sup>226</sup>Ra and/or <sup>232</sup>Th. Data from the gamme refiles of the logged auger holes are graphically represented in Fig. 3 through Fig. 6. Reings for depths between 0.5 and 1.2 m were greater than 1000 cpm in all holes. The maximum reading in auger hole 1 was 1489 cpm at 0.8 m, in auger hole 2 1499 cpm at 0.6 m. The maximum reading in hole 3 was 1565 cpm, also at 0.6 m.

#### SIGNIFICANCE OF FINDINGS

Measurements taken at 5 Hancock Street indicate that the property contained radioactive contamination primarily from the  $^{232}$ Th decay chain with slight contamination from the  $^{238}$ U decay chain. These radionuclide distributions are typical of the type of material originating from the processing operations at the MCW site. The concentration and extent of  $^{232}$ Th on this property is in excess of the applicable DOE criteria (Table 1). This material was found at sample location A4, as shown in Fig. 2. Based on the results of this radiological assessment, it is recommended that this site be considered for inclusion in the DOE remedial action program.

#### REFERENCES

- 1. W. D. Cottrell, ORNL, to A. J. Whitman, DOE/HQ, correspondence, "Radiological Survey of Private Properties in Lodi, New Jersey" (August 15, 1984).
- T.E. Myrick, B. A. Berven, W. D. Cottrell, W. A. Goldsmith, and F. F. Haywood, Procedures Manual for the ORNL Radiological Survey Activities (RASA) Program, Oak Ridge National Laboratory, ORNL/TM-8600 (April 1987).
- 3. U.S. Department of Energy, Guidelines for Residual Radioactive Material at Formerly Utilized Sites Remedial Action Program and Remote Surplus Facilities Management Program Sites (Rev. 2, March 1987).
- 4. U.S. Department of Energy, Radiological Survey of the Middelsex Municipal Landfill, Middlesex, New Jersey, DOE/EV-00005/20 (April 1980).
- 5. T.E. Myrick, B. A. Berven, and F. F. Haywood, State Background Radiation Levels: Results of Measurements Taken During 1975-1979, Oak Ridge National Laboratory, ORNL/IM-7343 (November 1981).

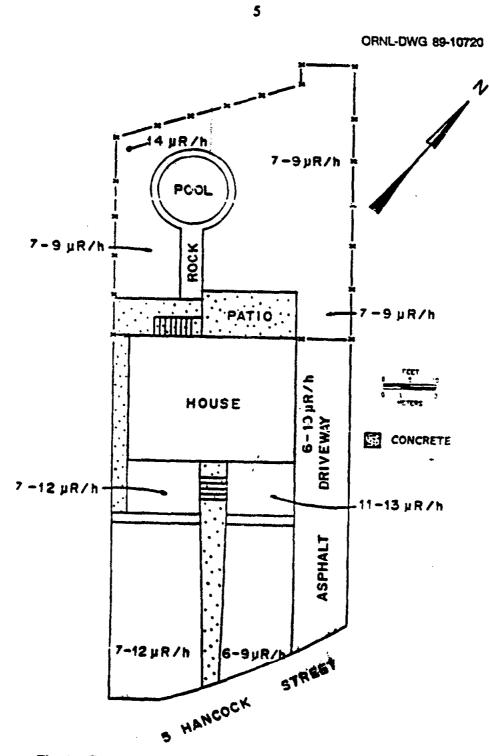

変に

というのとう

と、 のである、こののため、単位の単位の単位ので、 いたので


12

ì

Fig. 1. Gamma radiation levels (R/h) measured on the surface at 5 Hancock Street, Lodi, New Jersey (LJ029).



÷.

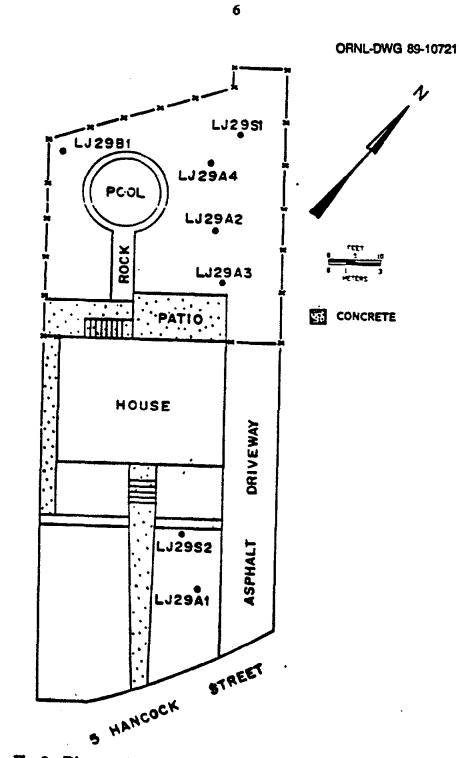

л. Ч

4.2

•

Fig. 2. Diagram showing locations of soil samples taken at 5 Hancock Street, Lodi, New Jersey (LJ029).

ORNL-DWG 89-107: ACTIVITY (1000 CPM) 1.6 1.4 1.2 1 0.8 0.6 œ 0.4 0.2 0 0.4 Q 0.8 1.2 1.6 2.4 2 2.8 DEPTH (N)

ĥ

1

4

l

Fig. 3. Gamma profile for auger hole 1 (LJ029A1) at 5 Hancock Street, Lodi, New Jersey.

06 4

. . .

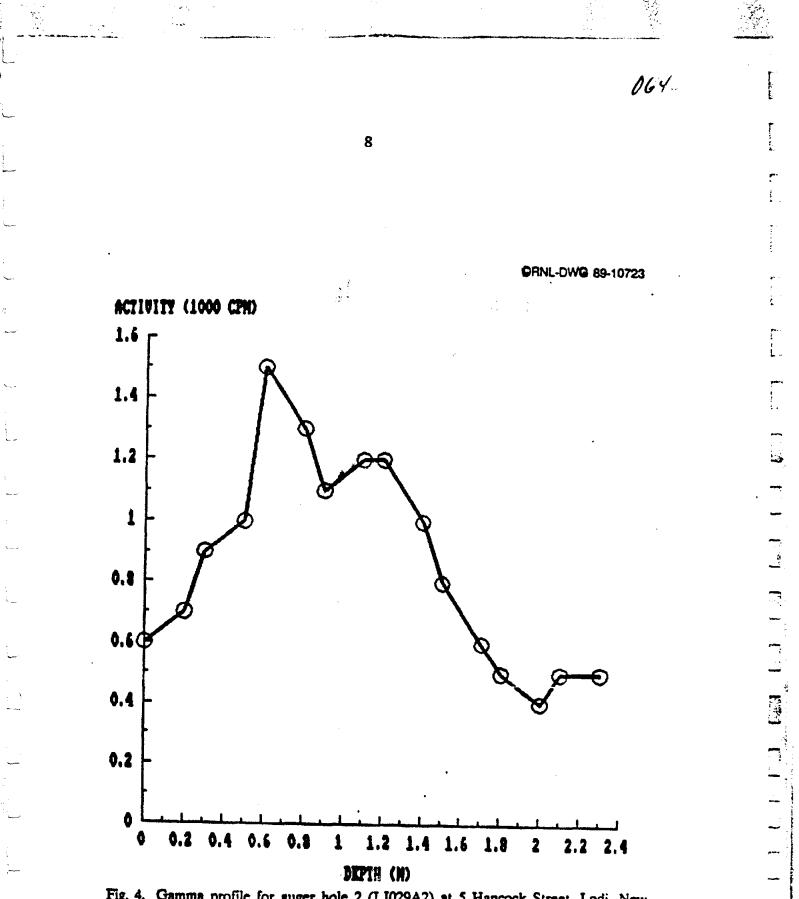


Fig. 4. Gamma profile for auger hole 2 (LJ029A2) at 5 Hancock Street, Lodi, New Jersey.


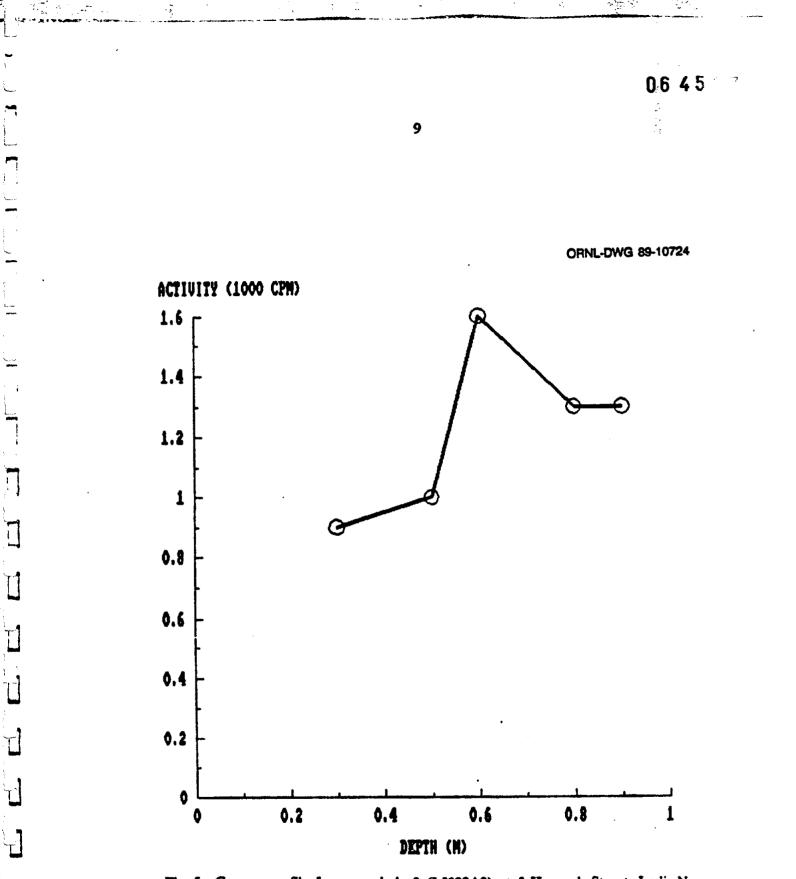


Fig. 5. Gamma profile for auger hole 3 (LJ029A3) at 5 Hancock Street, Lodi, New Jersey.

J

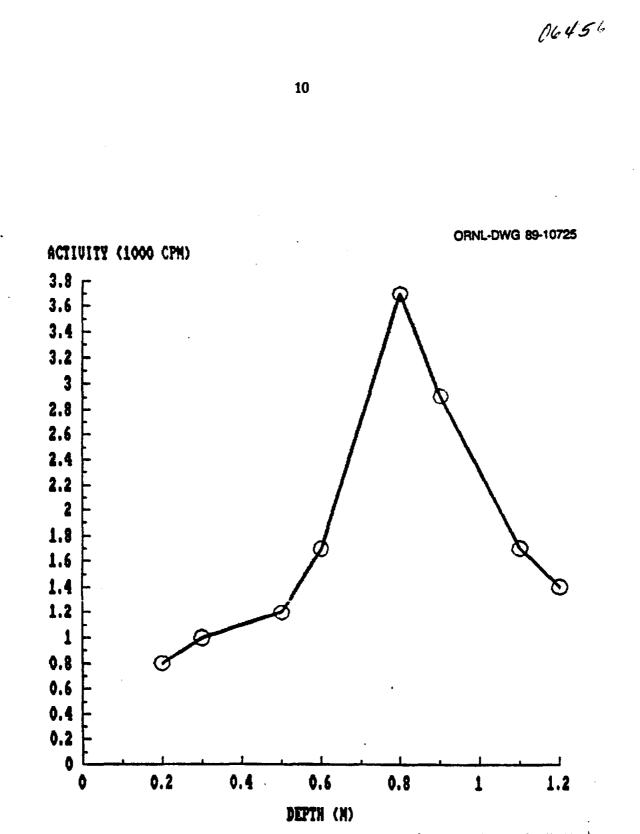

.

Ξ.

Fig. 6. Gamma profile for suger hole 4 (LJ029A4) at 5 Hancock Street, Lodi, New Jersey.

Mode of exposure	Exposure conditions	Guideline value
Radionuclide concen- trations in soil	Maximum permissible con- centration of the follow- ing radionuclides in soil above background levels averaged over 100 m <sup>2</sup> area 232Th 230Th 230Th 228Ra 226Ra	5 pCi/g averaged over th 15-cm of soil below the face; 15 pCi/g when ave over 15-cm thick soil 1 more than 15 cm below surface
	238U	Derived (site specific)

Table 1. Applicable guidelines for pro	stection against radiation <sup>4</sup>
--	---

•Reference 3.

「「「「「「「「「「「「「」」」」

1

.

# Table 2. Background radiation levels for the northern New Jersey area

Type of radiation measurement or sample	Radiation level or radionuclide concentration*
Gamma exposure at 1 m above ground surface ("R/h)	8,
Concentration of radionuclides in soil (pCi/g)	
226Ra	0.9
232Th	0.9
23817	· 0.9*

These values represent an average of normal radionuclide concentrations in this part of the state. Actual values may fluctuate.

\*Reference 4.

Reference 3.

11

37

ſ

064567

Sample <sup>a</sup>	Depth (cm)	Radionuclide concentration (pCi/g)		
		226 <sub>Ra</sub> b	232Thb	238UG
		Systematic sample	egd	
<b>S</b> 1	0-15	$0.75 \pm 0.2$	$0.78 \pm 0.3$	0.95
S2	0-15	$0.65 \pm 0.3$	$0.87 \pm 0.3$	1.0
		Biased samples	•	
BIA	0-15	$1.1 \pm 0.1$	$3.4 \pm 0.3$	1.3
BIB	15-30	$1.6 \pm 0.1$	$8.0 \pm 0.5$	1.9
BIC	30-45	$1.6 \pm 0.09$	8.2 ± 0.6	1.6
B1D	45-60	$1.7 \pm 0.2$	<b>8.4</b> ± 1.0	1.7
		Auger samples <sup>f</sup>		
AIA	<b>60-</b> 90	$1.8 \pm 0.09$	$2.1 \pm 0.2$	8
AIB	120-150	$0.71 \pm 0.05$	0.92 ± 0.03	1
A2A	30-60	$0.81 \pm 0.1$	$1.3 \pm 0.1$	8
A2B	60-90	$1.8 \pm 0.06$	$2.5 \pm 0.2$	8
A2C	120-150	$2.0 \pm 0.2$	$1.7 \pm 0.3$	8
A2D	150-185	$0.62 \pm 0.05$	$0.77 \pm 0.1$	8
A3A	30-45	0.78 ± 0.02	$1.3 \pm 0.09$	8
A3B	45-60	$0.70 \pm 0.09$	$1.1 \pm 0.1$	8
A3C	60-75	$0.85 \pm 0.04$	$2.9 \pm 0.3$	8
A3D	75-90	$1.2 \pm 0.03$	$1.4 \pm 0.3$	8
A4A	45-60	$0.80 \pm 0.05$	$1.1 \pm 0.2$	ľ
A4B	60-75	$1.3 \pm 0.08$	$6.7 \pm 0.8$	8
A4C	75-90	$1.9 \pm 0.2$	$19 \pm 1.7$	1
A4D	90-105	$2.1 \pm 0.04$	$2.4 \pm 0.2$	8

#### Table 3. Concentrations of radionuclides in soil at 5 Hancock Street, Lodi, New Jersey (LJ029)

12

\*Locations of soil samples are shown on Fig. 2.

Indicated counting error is at the 95% confidence level  $(\pm 2\sigma)$ .

Total analytical error of measurement results is less than  $\pm 5\%$  (95% confidence dSystematic samples are taken at locations irrespective of gamma exposure.

Biased samples are taken from areas shown to have elevated gamma exposure rates.

Auger samples are taken from holes drilled to further define the depth and extent of radioactive material. Holes are drilled where the surface may or may not be contaminated. Sample was not analyzed for <sup>238</sup>U.

Bern Str.

ORNL/RASA-8

#### INTERNAL DISTRIBUTION

B. A. Berven
 R. F. Carrier
 W. D. Cottrell
 A. G. Croff
 J. W. Crutcher
 L. M. Floyd
 7-11. R. D. Foley
 M. W. Francis
 S. V. Kaye

14. P. Y. Lu
15. J. O. Mynatt
16. P. T. Owen
17-19. R. E. Swaja
20. J. K. Williams
21. Central Research Library
22. IR&A Publications Office
23. Laboratory Records - RC
24. Y-12 Technical Library

#### EXTERNAL DISTRIBUTION

- 25. J. D. Berger, Oak Ridge Associated Universities, P.O. Box 117, Oak Ridge, TN 37831
- 26. R. W. Doane, Eberline, Inc., 800 Oak Ridge Turnpike, P.O. Box 350, Oak Ridge, Tn 37831
- 27. J. J. Fiore, U.S. Department of Energy, 19901 Germantown Road, Germantown, MD 20874
- 28-30. G. K. Hovey, Bechtel National, Inc., 800 Oak Ridge Turnpike, P.O. Box 350, Oak Ridge, TN 37831
  - 31. L. R. Levis, Roy F. Weston, Inc., 20030 Century Blvd., Germantown, MD 20874
  - 32. G. P. Turi, U.S. Department of Energy, 19901 Germantown Road, Germantown, MD 20874
  - 33. J. W. Wagoner, U.S. Department of Energy, 19901 Germantown Road, Germantown, MD 20874
- 34-36. Andrew Wallo III, U.S. Department of Energy, 19901 Germantown Road, Germantown, MD 20874
  - 37. Office of Assistant Manager, Energy Research and Development, Oak Ridge Operations Office, P.O. Box 2001, Oak Ridge, TN 37831-8600
- 38-39. Office of Scientific and Technical Information, DOE, P.O. Box 62, Oak Ridge, TN 37831