

M-211
097661 01

Formerly Utilized Sites Remedial Action Program (FUSRAP)

ADMINISTRATIVE RECORD

for Maywood, New Jersey



U.S. Department of Energy

097661

ORNL/RASA-92/6



**OAK RIDGE
NATIONAL
LABORATORY**

MARTIN MARIETTA

**RESULTS OF THE
RADIOLOGICAL SURVEY
AT
48 SCHLOSSER DRIVE,
ROCHELLE PARK, NEW JERSEY
(RJ005)**

**R. D. Foley
K. S. Brown**

**MANAGED BY
MARTIN MARIETTA ENERGY SYSTEMS, INC.
FOR THE UNITED STATES
DEPARTMENT OF ENERGY**

ORNL/RASA-92/6

HEALTH AND SAFETY RESEARCH DIVISION

Environmental Restoration and Waste Management Non-Defense Programs
(Activity No. EX 20 20 01 0; ADS317AEX)

**RESULTS OF THE RADIOLOGICAL SURVEY AT
48 SCHLOSSER DRIVE, ROCHELLE PARK, NEW JERSEY
(RJ005)**

R. D. Foley and K. S. Brown

Date Published - October 1992

Investigation Team

R. E. Swaja - Measurement Applications and Development Manager
W. D. Cottrell - Project Director
R. D. Foley - Field Survey Supervisor
W. Winton - Survey Team Member

Work performed by the
MEASUREMENT APPLICATIONS AND DEVELOPMENT GROUP

Prepared by the
OAK RIDGE NATIONAL LABORATORY
Oak Ridge, Tennessee 37831-6285
managed by
MARTIN MARIETTA ENERGY SYSTEMS, INC.
for the
U. S. DEPARTMENT OF ENERGY
under contract DE-AC05-84OR21400

CONTENTS

LIST OF FIGURES	v
LIST OF TABLES	vii
ACKNOWLEDGMENTS	ix
ABSTRACT	xi
INTRODUCTION	1
SURVEY METHODS	2
SURVEY RESULTS	2
Surface Gamma Radiation Levels	2
Systematic Soil Samples	3
Biased Soil Samples	3
SIGNIFICANCE OF FINDINGS	3
REFERENCES	4

LIST OF FIGURES

- 1 Gamma radiation levels ($\mu\text{R/h}$) measured on the surface at 48 Schlosser Drive, Rochelle Park, New Jersey (RJ005) 4
- 2 Diagram showing locations of soil samples taken at 48 Schlosser Drive, Rochelle Park, New Jersey (RJ005) 5
- 3 View looking north at 48 Schlosser Drive, Rochelle Park, New Jersey (RJ005) ... 6
- 4 View looking south at 48 Schlosser Drive, Rochelle Park, New Jersey (RJ005) ... 6

LIST OF TABLES

1	Applicable guidelines for protection against radiation	7
2	Background radiation levels for the northern New Jersey area	9
3	Concentrations of radionuclides in soil at 48 Schlosser Drive, Rochelle Park, New Jersey	10

ACKNOWLEDGMENTS

This project was sponsored by the Office of Environmental Restoration, U.S. Department of Energy, under contract DE-AC05-84OR21400 with Martin Marietta Energy Systems, Inc. The authors wish to acknowledge the contributions of W. D. Cottrell, V. P. Patania, and D. A. Roberts of the Measurement Applications and Development Group, Oak Ridge National Laboratory, for participation in the analyses, editing, and reporting of data for this survey. The authors also wish to thank J. F. Allred and D. A. Rose for sample preparation and T. R. Stewart for computer graphics. The graphics assistance of Scott Thompson is also appreciated.

ABSTRACT

Maywood Chemical Works (MCW) of Maywood, New Jersey, generated process wastes and residues associated with the production and refining of thorium and thorium compounds from monazite ores from 1916 to 1956. MCW supplied rare earth metals and thorium compounds to the Atomic Energy Commission and various other government agencies from the late 1940s to the mid-1950s. Area residents used the sandlike waste from this thorium extraction process mixed with tea and cocoa leaves as mulch in their yards. Some of these contaminated wastes were also eroded from the site into Lodi Brook. At the request of the U.S. Department of Energy (DOE), a group from Oak Ridge National Laboratory conducts investigative radiological surveys of properties in the vicinity of MCW to determine whether a property is contaminated with radioactive residues, principally ^{232}Th , derived from the MCW site. The survey typically includes direct measurement of gamma radiation levels and soil sampling for radionuclide analyses. The survey of this site, 48 Schlosser Drive, Rochelle Park, New Jersey (RJ005), was conducted on July 14, 1991.

Results of the survey demonstrated no radionuclide concentrations in excess of the DOE Formerly Utilized Sites Remedial Action Program criteria. The radionuclide distributions were not significantly different from normal background levels in the northern New Jersey area.

RESULTS OF THE RADIOLOGICAL SURVEY AT 48 SCHLOSSER DRIVE, ROCHELLE PARK, NEW JERSEY (RJ005)*

INTRODUCTION

From 1916 to 1956, process wastes and residues associated with the production and refining of thorium and thorium compounds from monazite ores were generated by the Maywood Chemical Works (MCW), Maywood, New Jersey. During the latter part of this period, MCW supplied rare earth metals and thorium compounds to various government agencies. In the 1940s and 1950s, MCW produced thorium and lithium, under contract, for the Atomic Energy Commission (AEC). These activities ceased in 1956, and, approximately three years later, the 30-acre real estate was purchased by the Stepan Company. The property is located at 100 Hunter Avenue in a highly developed area in Maywood and Rochelle Park, Bergen County, New Jersey.

During the early years of operation, MCW stored wastes and residues in low-lying areas west of the processing facilities. In the early 1930s, these areas were separated from the rest of the property by the construction of New Jersey State Highway 17. The Stepan property, the interim storage facility, and several vicinity properties have been designated for remedial action by the Department of Energy (DOE).

The waste produced by the thorium extraction process was a sandlike material containing residual amounts of thorium and its decay products, with smaller quantities of uranium and its decay products. During the years 1928 and 1944 to 1946, area residents used these process wastes mixed with tea and cocoa leaves as mulch in their lawns and gardens. In addition, some of the contaminated wastes were apparently eroded from the site into Lodi Brook and carried downstream.

Lodi Brook is a small stream flowing south from Maywood with its headwaters near the Stepan waste storage site. Approximately 150 ft after passing under State Route 17, the stream has been diverted underground through concrete or steel culverts until it merges with the Saddle River in Lodi, New Jersey. Only a small section near Interstate 80 remains uncovered. From the 1940s to the 1970s when the stream was being diverted underground, its course was altered several times. Some of these changes resulted in the movement of contaminated soil to the surface of a few properties, where it is still in evidence. In other instances, the contaminated soil was covered over or mixed with clean fill, leaving no immediate evidence on the surface. Therefore, properties in question may be drilled in search of former streambed material, even in the absence of surface contamination.

As a result of the Energy and Water Appropriations Act of Fiscal Year 1984, the property discussed in this report and properties in its vicinity contaminated with residues from

*The survey was performed by members of the Measurement Applications and Development Group of the Health and Safety Research Division at Oak Ridge National Laboratory under DOE contract DE-AC05-84OR21400.

the former MCW were included as a decontamination research and development project under the DOE Formerly Utilized Sites Remedial Action Program. As part of this project, DOE is conducting radiological surveys in the vicinity of the site to identify properties contaminated with residues derived from the MCW. The principal radionuclide of concern is thorium-232. The radiological survey discussed in this report is part of that effort and was conducted, at the request of DOE and the property owner, by members of the Measurement Applications and Development Group of the Oak Ridge National Laboratory.

A radiological survey of the private, residential property at 48 Schlosser Drive, Rochelle Park, New Jersey, was conducted on July 14, 1991 and is summarized in this report. A local resident reported that material from the MCW was used for top soil on this property.

SURVEY METHODS

The radiological survey of the property included: (1) a gamma scan of the entire property surface outdoors at the surface, and (2) collection of surface and subsurface soil samples. No indoor survey measurements were performed. The survey methods followed the basic plan outlined in a correspondence from W. D. Cottrell to A. J. Whitman.¹ A comprehensive description of the survey methods and instrumentation has been presented in another report.²

Using a portable gamma scintillation meter, ranges of gamma exposure rates were recorded for areas of the property surface. Three systematic soil samples were obtained at randomly selected locations irrespective of the gamma exposure rates. Two biased soil samples were collected. All soil samples were analyzed for ²²⁶Ra, ²³²Th, and ²³⁸U content.

SURVEY RESULTS

Applicable DOE guidelines are summarized in Table 1.³ The normal background radiation levels for the northern New Jersey area are presented in Table 2.^{4,5} These data are provided for comparison with survey results presented in this report. All direct measurement results presented in this report are gross readings; background radiation levels have not been subtracted. Similarly, background concentrations have not been subtracted from radionuclide concentrations measured in soil samples.

Current photographs of the site are shown in Figs. 3 and 4.

Surface Gamma Radiation Levels

Gamma radiation levels measured during a gamma scan of the property surface are given in Fig. 1. Gamma exposure rates over the major portion of the property ranged from 6 to 7 μ R/h. The highest gamma levels at the surface ranged from 6-18 μ R/h on the asphalt driveway. The asphalt over the sampling location for biased samples B1A and B1B measured 18 to 20 μ R/h at 0 to 2 inches depth.

Systematic Soil Samples

Systematic soil samples were taken from various locations on the property for radionuclide analyses. Locations of the systematic samples (S) are shown in Fig. 2, with results of laboratory analyses provided in Table 3. Concentrations of ^{226}Ra , ^{232}Th , and ^{238}U in these samples ranged from 0.46 to 0.59 pCi/g, 0.45 to 0.61 pCi/g, and <1.8 to 2.70 pCi/g, respectively. All samples were below DOE criteria (Table 1) and near typical background levels for the northern New Jersey area (Table 2).

Biased Soil Samples

Two biased soil samples were taken from different depths at one location on the asphalt driveway for radionuclide analyses. The sample location (S) is shown in Fig. 2, with results of laboratory analyses provided in Table 3. Concentrations of ^{226}Ra , ^{232}Th , and ^{238}U in these samples ranged from 0.37 to 1.0 pCi/g, 0.43 to 1.9 pCi/g, and <1.5 to <3.0 pCi/g, respectively. Both samples were below DOE criteria (Table 1) and near typical background levels for the northern New Jersey area (Table 2).

SIGNIFICANCE OF FINDINGS

Measurements and results of soil sample analyses taken at 48 Schlosser Drive indicate that the property contains no significant radioactive contamination above normal background levels in this area. Radiological assessments of soil samples from the site demonstrate no radionuclide concentrations in excess of applicable Federal guidelines. The elevation in gamma levels on the asphalt driveway might be typical of the naturally occurring radioactive substances present in bricks, concrete, asphalt, and other such materials used in paving and building construction.

REFERENCES

1. W. D. Cottrell, ORNL, to A. J. Whitman, DOE/HQ, correspondence, "Radiological Survey of Private Properties in Lodi, New Jersey" (August 15, 1984).
2. T. E. Myrick, B. A. Berven, W. D. Cottrell, W. A. Goldsmith, and F. F. Haywood, *Procedures Manual for the ORNL Radiological Survey Activities (RASA) Program*, Oak Ridge National Laboratory, ORNL/TM-8600 (April 1987).
3. U.S. Department of Energy, *Guidelines for Residual Radioactive Material at Formerly Utilized Sites Remedial Action Program and Remote Surplus Facilities Management Program Sites* (Rev. 2, March 1987).
4. U.S. Department of Energy, *Radiological Survey of the Middlesex Municipal Landfill, Middlesex, New Jersey*, DOE/EV-00005/20 (April 1980).
5. T. E. Myrick, B. A. Berven, and F. F. Haywood, *State Background Radiation Levels: Results of Measurements Taken During 1975-1979*, Oak Ridge National Laboratory, ORNL/TM-7343 (November 1981).

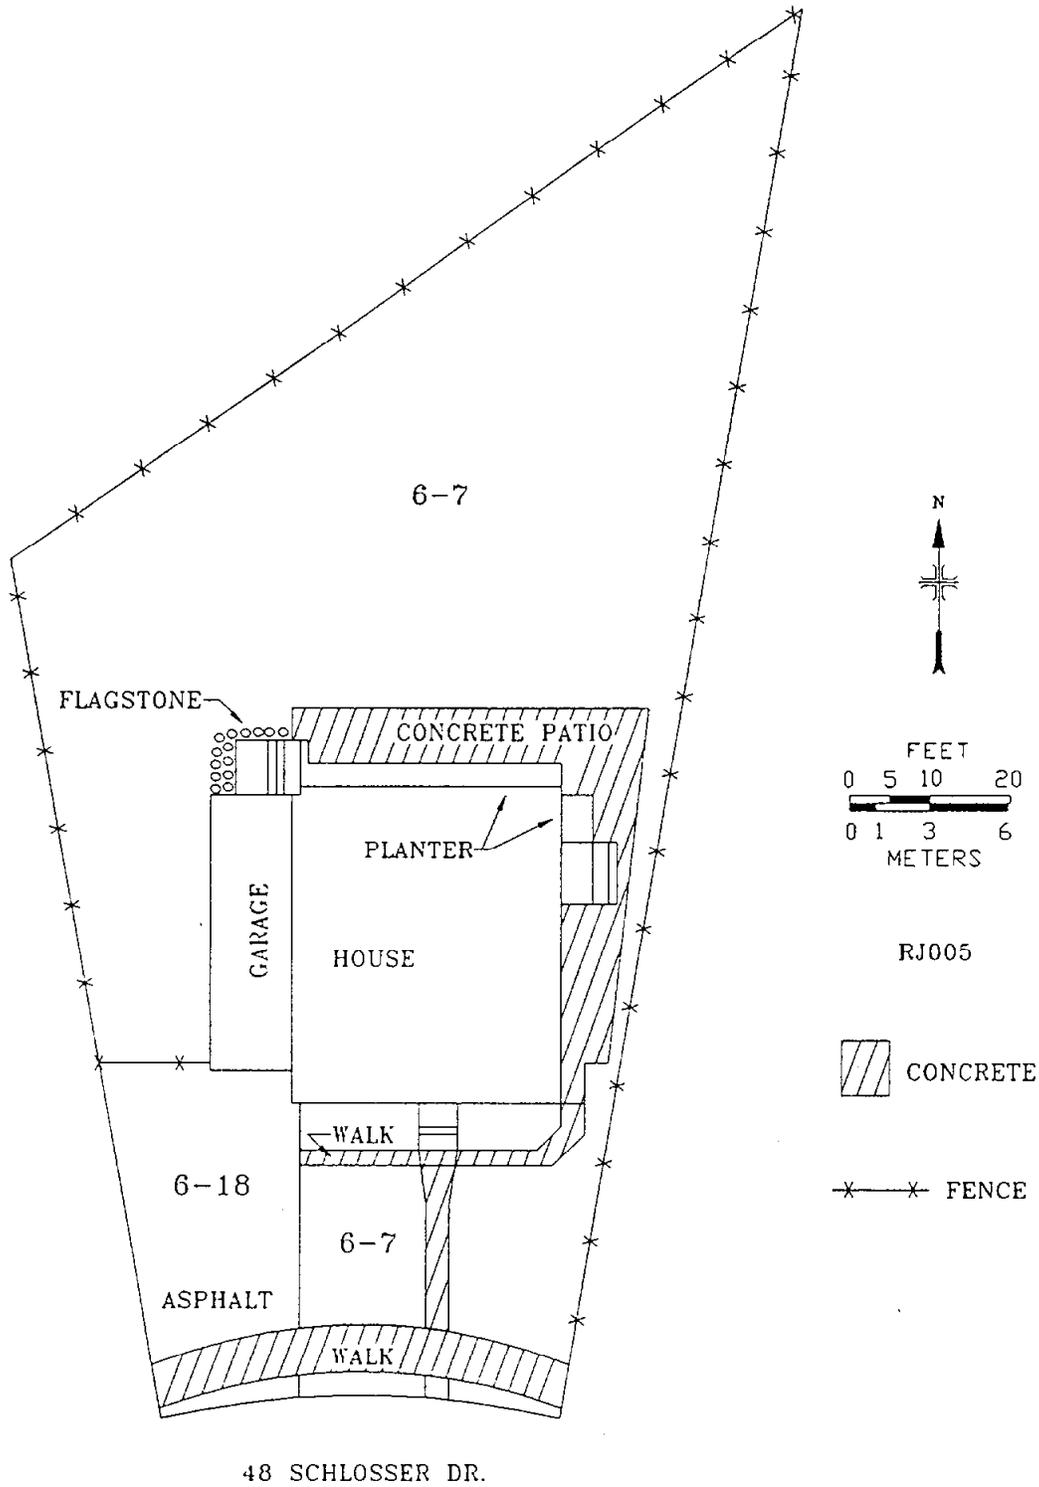


Fig. 1. Gamma radiation levels ($\mu\text{R/h}$) measured on the surface at 48 Schlosser Drive, Rochelle Park, New Jersey (RJ005).


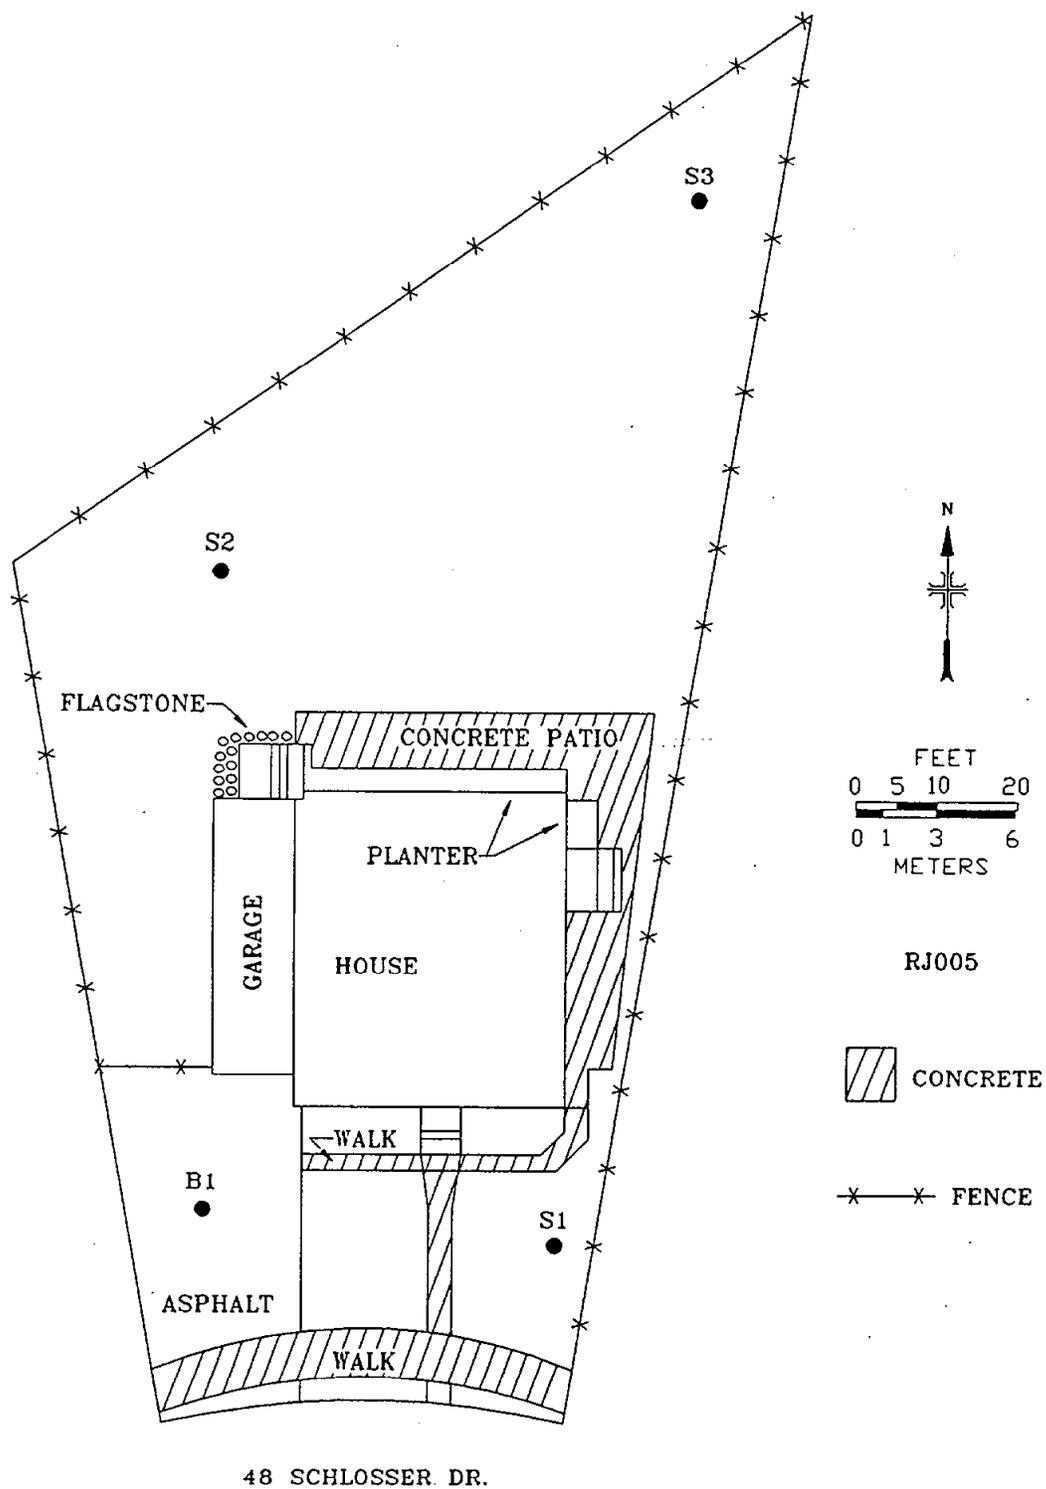


Fig. 2. Diagram showing locations of soil samples taken at 48 Schlosser Drive, Rochelle Park, New Jersey (RJ005).



ORNL PHOTO-7010-92

Fig. 3. View looking north at 48 Schlosser Drive, Rochelle Park, New Jersey (RJ005).

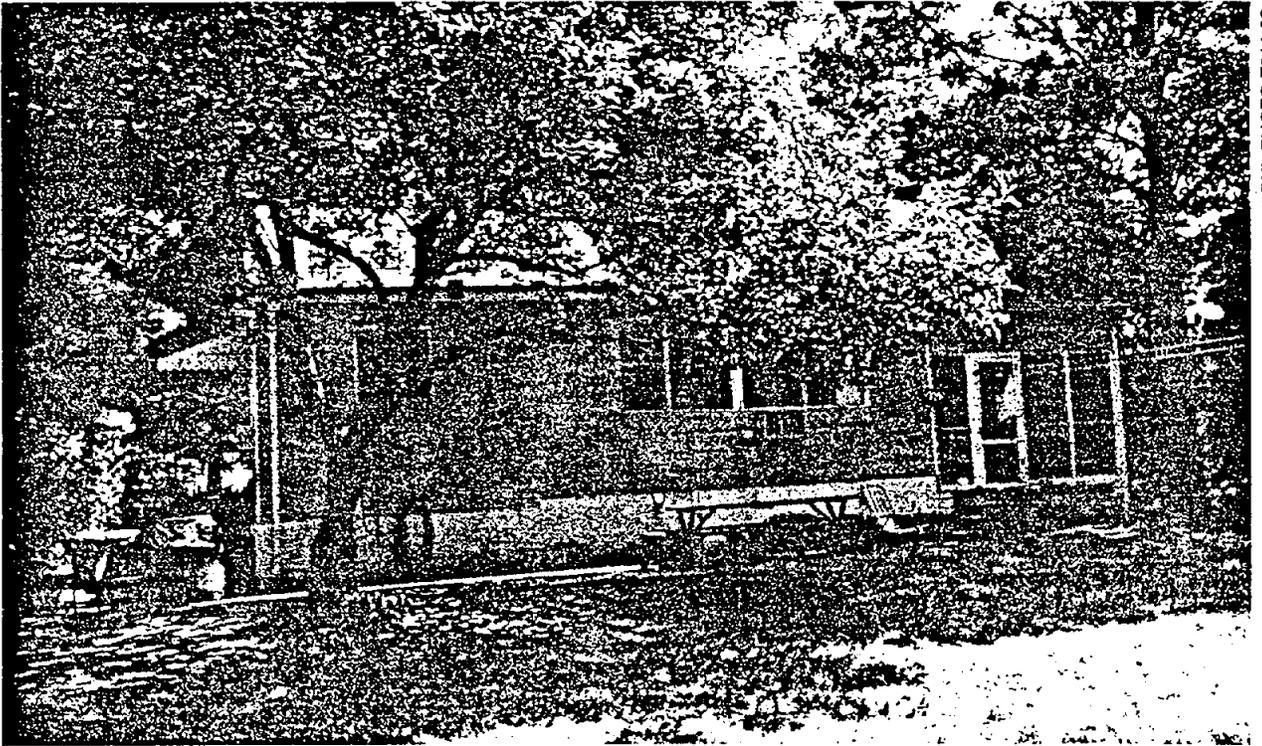

ORNL PHOTO-7011-92

Fig. 4. View looking south at 48 Schlosser Drive, Rochelle Park, New Jersey (RJ005).

Table 1. Applicable guidelines for protection against radiation
(Limits for uncontrolled areas)

Mode of exposure	Exposure conditions	Guideline value
Total residual surface contamination ^a	²³⁸ U, ²³⁵ U, U-natural (alpha emitters)	
	or	
	Beta-gamma emitters ^b	
	Maximum	15,000 dpm/100 cm ²
	Average	5,000 dpm/100 cm ²
	Removable	1,000 dpm/100 cm ²
	²³² Th, Th-natural (alpha emitters)	
	or	
	⁹⁰ Sr (beta-gamma emitter)	
	Maximum	3,000 dpm/100 cm ²
Average	1,000 dpm/100 cm ²	
Removable	200 dpm/100 cm ²	
	²²⁶ Ra, ²³⁰ Th, transuranics	
	Maximum	300 dpm/100 cm ²
	Average	100 dpm/100 cm ²
	Removable	20 dpm/100 cm ²
Beta-gamma dose rates	Surface dose rate averaged over not more than 1 m ²	0.20 mrad/h
	Maximum dose rate in any 100-cm ² area	1.0 mrad/h
Radionuclide concentrations in soil (generic)	Maximum permissible concentration of the following radionuclides in soil above background levels, averaged over a 100-m ² area ²²⁶ Ra ²³² Th ²³⁰ Th	5 pCi/g averaged over the first 15 cm of soil below the surface; 15 pCi/g when averaged over 15-cm-thick soil layers more than 15 cm below the surface

Table 1 (continued)

Mode of Exposure	Exposure conditions	Guideline value
Derived concentrations	²³⁸ U Concentration limit in surface soil above background levels based on dose estimates from major exposure pathways	Site specific ^c

^aDOE surface contamination guidelines are consistent with *NRC Guidelines for Decontamination at Facilities and Equipment Prior to Release for Unrestricted Use or Termination of Licenses for By-Product, Source, or Special Nuclear Material*, May 1987.

^bBeta-gamma emitters (radionuclides with decay modes other than alpha emission or spontaneous fission) except ⁹⁰Sr, ²²⁸Ra, ²²³Ra, ²²⁷Ac, ¹³³I, ¹²⁹I, ¹²⁶I, ¹²⁵I.

^cDOE guidelines for uranium are derived on a site-specific basis. Guidelines of 35-40 pCi/g have been applied at other FUSRAP sites. *Source*: J. L. Marley and R. F. Carrier, *Results of the Radiological Survey at 4 Elmhurst Avenue, Colonie, New York (AL219)*, ORNL/RASA-87/117, Martin Marietta Energy Systems, Inc., Oak Ridge Natl. Lab., February 1988; B. A. Berven et al., *Radiological Survey of the Former Kellex Research Facility, Jersey City, New Jersey*, DOE/EV-0005/29, ORNL-5734, Martin Marietta Energy Systems, Inc., Oak Ridge Natl. Lab., February 1982.

Sources: Adapted from U.S. Department of Energy, DOE Order 5400.5, April 1990, and U.S. Department of Energy, *Guidelines for Residual Radioactive Material at Formerly Utilized Sites Remedial Action Program and Remote Surplus Facilities Management Program Sites*, Rev. 2, March 1987.

Table 2. Background radiation levels for the northern New Jersey area

Type of radiation measurement or sample	Radiation level or radionuclide concentration ^a
Gamma exposure at 1 m above ground surface ($\mu\text{R/h}$)	8 ^b
Concentration of radionuclides in soil (pCi/g)	
²²⁶ Ra	0.9 ^c
²³² Th	0.9 ^c
²³⁸ U	0.9 ^c

^aThese values represent an average of normal radionuclide concentrations in this part of the state. Actual values may fluctuate.

^bReference 4.

^cReference 5.

Table 3. Concentrations of radionuclides in soil at 48 Schlosser Drive, Rochelle Park, New Jersey (RJ005)

Sample ^a	Depth (cm)	Radionuclide concentration (pCi/g)		
		²²⁶ Ra ^b	²³² Th ^b	²³⁸ U ^c
<i>Biased samples^d</i>				
B1A	5-20	1.0±0.04	1.9±0.06	<3.0
B1B	20-35	0.37±0.03	0.43±0.05	<1.5
<i>Systematic samples^e</i>				
S1	0-15	0.59±0.03	0.55±0.06	2.70±1.27
S2	0-15	0.46±0.03	0.45±0.05	<2.3
S3	0-15	0.52±0.03	0.61±0.06	<1.8

^aLocations of soil samples are shown on Fig. 2.

^bIndicated counting error is at the 95% confidence level ($\pm 2\sigma$).

^cTotal analytical error of measurement results is less than $\pm 5\%$ (95% confidence level).

^dBiased samples are taken from areas with elevated gamma exposure rates.

^eSystematic samples are taken at locations irrespective of gamma exposure rates.

INTERNAL DISTRIBUTION

- | | |
|--------------------|-------------------------------|
| 1. B. A. Berven | 22. R. E. Rodriguez |
| 2-7. K. J. Brown | 23. P. S. Rohwer |
| 8. R. F. Carrier | 24-26. R. E. Swaja |
| 9. W. D. Cottrell | 27. M. S. Uziel |
| 10-15. R. D. Foley | 28. J. K. Williams |
| 16. R. O. Hultgren | 29-30. Laboratory Records |
| 17. C. A. Johnson | 31. Laboratory Records - RC |
| 18. S. V. Kaye | 32. Central Research Library |
| 19. M. E. Murray | 33. ORNL Technical Lib., Y-12 |
| 20. P. T. Owen | 34. ORNL Patent Section |
| 21. D. A. Roberts | 35-40. MAD Records Center |

EXTERNAL DISTRIBUTION

41. J. D. Berger, Oak Ridge Associated Universities, E/SH Division, Environmental Survey and Site Assessment Program, P.O. Box 117, Oak Ridge, TN 37831-0117
42. James J. Fiore, Director, Office of Eastern Area Programs, Office of Environmental Restoration, U.S. Department of Energy, (EM-42), Trevion II, Washington, DC 20585
- 43-45. G. K. Hovey, Bechtel National, Inc., FUSRAP Department, Oak Ridge Corporate Center, 151 Lafayette Drive, P.O. Box 350, Oak Ridge, TN 37831-0350
- 46-48. Jerry King, Science Applications International Corp., P.O. Box 2501, 301 Laboratory Road, Oak Ridge, TN 37831
49. L. K. Price, Director, Former Sites Restoration Division, Oak Ridge Field Office, U.S. Department of Energy, P.O. Box 2001, Oak Ridge, TN 37831-8723
50. James W. Wagoner II, Director, Division of Off-Site Programs, Office of Eastern Area Programs, Office of Environmental Restoration, U.S. Department of Energy, (EM-421), Trevion II, Washington, DC 20585
- 51-55. W. Alexander Williams, Designation and Certification Manager, Division of Off-Site Programs, Office of Eastern Area Programs, Office of Environmental Restoration, U.S. Department of Energy, (EM-421), Trevion II, Washington, DC 20585
56. C. D. Young, Office of Technical Services, Roy F. Weston, Inc., 12850 Middlebrook Road, Suite 210, Germantown, MD 20874
- 57-59. Office of Scientific and Technical Information, U.S. Department of Energy, P.O. Box 62, Oak Ridge, TN 37831