

M-690

---

Formerly Utilized Sites Remedial Action Program (FUSRAP)

---

# ADMINISTRATIVE RECORD

for the Maywood Site, New Jersey

---



**US Army Corps  
of Engineers®**

M-690

ORNL/RASA-88/57

**HEALTH AND SAFETY RESEARCH DIVISION**

**Nuclear and Chemical Waste Programs  
(Activity No. AH 10 05 00 0; ONLWC01)**

**RESULTS OF THE RADIOLOGICAL  
SURVEY AT 99 GARIBALDI AVENUE, LODI,  
NEW JERSEY (LJ064)**

**R. D. Foley, L. M. Floyd, and J. W. Crutcher**

**Date Published - July 1989**

**Investigation Team**

**R. E. Swaja - Measurement Applications and Development Manager  
W. D. Cottrell - FUSRAP Project Director  
R. D. Foley - Field Survey Supervisor**

**Survey Team Members**

**K. S. Dickerson  
A. K. Klitz  
R. A. Mathis  
W. H. Shinpaugh\*  
W. Winton**

**\*Stone Associates**

**Work performed by the  
MEASUREMENT APPLICATIONS AND DEVELOPMENT GROUP**

**Prepared by the  
OAK RIDGE NATIONAL LABORATORY  
Oak Ridge, Tennessee 37831-6285  
operated by  
MARTIN MARIETTA ENERGY SYSTEMS, INC.  
for the  
U.S. DEPARTMENT OF ENERGY  
under Contract No. DE-AC05-84OR21400**

## CONTENTS

LIST OF FIGURES .....	v
LIST OF TABLES .....	vii
ACKNOWLEDGMENTS .....	ix
ABSTRACT .....	xi
INTRODUCTION .....	1
SURVEY METHODS .....	2
SURVEY RESULTS .....	2
Surface Gamma Radiation Levels .....	3
Systematic and Biased Soil Samples .....	3
Auger Soil Samples .....	3
SIGNIFICANCE OF FINDINGS .....	4
REFERENCES .....	4

## LIST OF FIGURES

1	Gamma radiation levels ( $\mu\text{R}/\text{h}$ ) measured on the surface at 99 Garibaldi Avenue, Lodi, New Jersey (LJ064) .....	5
2	Diagram showing locations of soil samples taken at 99 Garibaldi Avenue, Lodi, New Jersey (LJ064) .....	6
3	Gamma profile for auger hole 1 at 99 Garibaldi Avenue, Lodi, New Jersey .....	7
4	Gamma profile for auger hole 2 at 99 Garibaldi Avenue, Lodi, New Jersey .....	8
5	Gamma profile for auger hole 3 at 99 Garibaldi Avenue, Lodi, New Jersey .....	9
6	Gamma profile for auger hole 4 at 99 Garibaldi Avenue, Lodi, New Jersey .....	10
7	Gamma profile for auger hole 5 at 99 Garibaldi Avenue, Lodi, New Jersey .....	11
8	Gamma profile for auger hole 6 at 99 Garibaldi Avenue, Lodi, New Jersey .....	12

## LIST OF TABLES

1	Applicable guidelines for protection against radiation .....	13
2	Background radiation levels for the northern New Jersey area .....	13
3	Concentrations of radionuclides in soil at 99 Garibaldi Avenue, Lodi, New Jersey (LJ064) .....	14

## ACKNOWLEDGMENTS

Research for this project was sponsored by the Division of Facility and Site Decommissioning Projects, U.S. Department of Energy, under Contract No. DE-AC05-84OR21400 with Martin Marietta Energy Systems, Inc. The authors wish to acknowledge the support of J. E. Baublitz, Acting Director, Office of Remedial Action and Waste Technology; J. J. Fiore, Director, Division of Facility and Site Decommissioning Projects; and members of their staffs. The authors also appreciate the contributions of J. L. Rich, S. W. Hawthorne, B. C. Littleton, and L. J. Jeffers of the Publications Division; M. S. Uziel of the Environmental Information Systems Group; D. A. Roberts, and T. R. Stewart of the Measurement Applications and Development Group; B. S. Ellis former employee of Martin Marietta Energy Systems, Inc.; and W. H. Shinpaugh of Don Stone Associates for participation in the collection, analyses, editing, and reporting of data for this survey.

## ABSTRACT

Maywood Chemical Works (MCW) of Maywood, New Jersey, generated process wastes and residues associated with the production and refining of thorium and thorium compounds from monazite ores from 1916 to 1956. MCW supplied rare earth metals and thorium compounds to the Atomic Energy Commission and various other government agencies from the late 1940s to the mid-1950s. Area residents used the sandlike waste from this thorium extraction process mixed with tea and cocoa leaves as mulch in their yards. Some of these contaminated wastes were also eroded from the site into Lodi Brook. At the request of the U.S. Department of Energy (DOE), a group from Oak Ridge National Laboratory conducts investigative radiological surveys of properties in the vicinity of MCW to determine whether a property is contaminated with radioactive residues, principally  $^{232}\text{Th}$ , derived from the MCW site. The survey typically includes direct measurement of gamma radiation levels and soil sampling for radionuclide analyses. The survey of this site, 99 Garibaldi Avenue, Lodi, New Jersey (LJ064), was conducted during 1987.

Results of the survey demonstrated radionuclide concentrations in excess of the DOE Formerly Utilized Sites Remedial Action Program criteria. The radionuclide distributions are typical of the type of material originating from the MCW site.

# RESULTS OF THE RADIOLOGICAL SURVEY AT 99 GARIBALDI AVENUE, LODI, NEW JERSEY (LJ064)\*

## INTRODUCTION

From 1916 to 1956, process wastes and residues associated with the production and refining of thorium and thorium compounds from monazite ores were generated by the Maywood Chemical Works (MCW), Maywood, New Jersey. During the latter part of this period, MCW supplied rare earth metals and thorium compounds to various government agencies. In the 1940s and 1950s, MCW produced thorium and lithium, under contract, for the Atomic Energy Commission (AEC). These activities ceased in 1956, and, approximately three years later, the 30-acre real estate was purchased by the Stepan Company. The property is located at 100 Hunter Avenue in a highly developed area in Maywood and Rochelle Park, Bergen County, New Jersey.

During the early years of operation, MCW stored wastes and residues in low-lying areas west of the processing facilities. In the early 1930s, these areas were separated from the rest of the property by the construction of New Jersey State Highway 17. The Stepan property, the interim storage facility, and several vicinity properties have been designated for remedial action by the U.S. Department of Energy (DOE).

The waste produced by the thorium extraction process was a sandlike material containing residual amounts of thorium and its decay products, with smaller quantities of uranium and its decay products. During the years 1928 and 1944 to 1946, area residents used these process wastes mixed with tea and cocoa leaves as mulch in their lawns and gardens. In addition, some of the contaminated wastes were apparently eroded from the site into Lodi Brook and carried downstream.

Lodi Brook is a small stream flowing south from Maywood with its headwaters near the Stepan waste storage site. Approximately 150 ft after passing under State Route 17, the stream has been diverted underground through concrete or steel culverts until it merges with the Saddle River in Lodi, New Jersey. Only a small section near Interstate 80 remains uncovered. From the 1940s to the 1970s when the stream was being diverted underground, its course was altered several times. Some of these changes resulted in the movement of contaminated soil to the surface of a few properties, where it is still in evidence. In other instances, the contaminated soil was covered over or mixed with clean fill, leaving no immediate evidence on the surface. Therefore, properties in question may be drilled in search of former stream bed material, even in the absence of surface contamination.

---

\*The survey was performed by members of the Measurement Applications and Development Group of the Health and Safety Research Division at Oak Ridge National Laboratory under U.S. DOE contract DE-AC05-84OR21400.

As a result of the Energy and Water Appropriations Act of Fiscal Year 1984, the property discussed in this report and properties in its vicinity contaminated with residues from the former MCW were included as a decontamination research and development project under the DOE Formerly Utilized Sites Remedial Action Program. As part of this project, DOE is conducting radiological surveys in the vicinity of the site to identify properties contaminated with residues derived from the MCW. The principal radionuclide of concern is thorium-232. The radiological surveys discussed in this report are part of that effort and were conducted, at the request of DOE, by members of the Measurement Applications and Development Group of the Oak Ridge National Laboratory.

A radiological survey of the private, residential property at 99 Garibaldi Avenue, Lodi, New Jersey, was conducted during 1987. The survey and sampling of the ground surface, as well as the subsurface investigation, were carried out on June 1-3, 1987.

## SURVEY METHODS

The radiological survey of the property included: (1) a gamma scan of the entire property outdoors, (2) collection of surface and subsurface soil samples, and (3) gamma profiles of auger holes. No indoor survey measurements were performed.

Using a portable gamma scintillation meter, ranges of measurements were recorded for areas of the property surface. If the gamma exposure rates were elevated, a biased soil sample was taken at the point showing the highest gamma radiation level. Systematic soil samples were taken at various locations on the property, irrespective of gamma radiation levels. These survey methods followed the plan outlined in Reference 1.

To define the extent of possible subsurface soil contamination, the auger holes were drilled to depths of approximately 2.3 m. A plastic pipe was placed in each hole, and a NaI scintillation probe was lowered inside the pipe. The probe was encased in a lead shield with a horizontal row of collimating slits on the side. This collimation allows measurement of gamma radiation intensities resulting from contamination within small fractions of the hole depth. Measurements were usually made at 15- or 30-cm intervals. If the gamma readings in the hole were elevated, a soil sample was scraped from the wall of the auger hole at the point showing the highest gamma radiation level. The auger hole loggings were used to select locations where further soil sampling would be useful. A split-spoon sampler was used to collect subsurface samples at known depths. In some auger holes, a combination of split-spoon sampling and side-wall scraping was used to collect samples. A comprehensive description of the survey methods and instrumentation has been presented in another report.<sup>2</sup>

## SURVEY RESULTS

Applicable federal guidelines are summarized in Table 1.<sup>3</sup> The normal background radiation levels for the northern New Jersey area are presented in Table 2.<sup>4</sup> These data are provided for comparison with survey results presented in this section. All direct measurement results presented in this report are gross readings; background radiation levels

have not been subtracted. Similarly, background concentrations have not been subtracted from radionuclide concentrations measured in environmental samples.

### Surface Gamma Radiation Levels

Gamma radiation levels measured during a gamma scan of the property surface are given in Fig. 1. Gamma exposure rates over the major portion of the property ranged from 5 to 9  $\mu\text{R}/\text{h}$ . The highest gamma levels were found in an isolated spot in the front yard, measuring 10 to 21  $\mu\text{R}/\text{h}$ . A larger area to the west of the house measured 10 to 15  $\mu\text{R}/\text{h}$ . These two areas are indicated in Fig. 1 with shading. The concrete north of the garage measured 9 to 12  $\mu\text{R}/\text{h}$ , and portions of the sidewalk on Brook Street measured 9 to 13  $\mu\text{R}/\text{h}$ . The soil along the eastern side of the garage measured 11  $\mu\text{R}/\text{h}$ .

### Systematic and Biased Soil Samples

Systematic and biased soil samples were taken from various locations on the property for radionuclide analyses. Locations of the systematic (S) and biased (B) samples are shown in Fig. 2, with results of laboratory analyses provided in Table 3. Concentrations of radium and thorium in the biased samples ranged from 0.90 to 1.2 pCi/g and 5.2 to 9.8 pCi/g, respectively. All samples were near or above background for the northern New Jersey area (Table 2). All thorium concentrations in the biased samples were above DOE guidelines for the first 15 cm of soil (Table 1).

### Auger Soil Samples

Varying thicknesses of subsurface soil were sampled from depths of 0 to 185 cm in auger holes (A) drilled at six separate locations indicated in Fig. 2, except for A3 and A5 which were not sampled due to the absence of elevated gamma activity. The results of analyses of these samples are given in Table 3. Concentrations of  $^{226}\text{Ra}$  and  $^{232}\text{Th}$  in soil samples from four auger holes ranged from 0.37 to 6.6 and 0.57 to 100 pCi/g, respectively. Radionuclide concentrations for thorium were above DOE criteria (Table 1) in samples A1B&C, A4H-J, and A6H, with levels of 25, 20, 100, 38, 22, and 38 pCi/g, respectively. Elevated concentrations were found at various depths between 15 and 150 cm.

Gamma logging was performed in each of the six auger holes to characterize and further define the extent of possible contamination. The logging technique used here is not radionuclide specific. However, logging data, in conjunction with soil analyses data, may be used to estimate regions of elevated radionuclide concentrations in auger holes when compared with background levels for the area. Following a comparison of these data, it appears that any shielded scintillator readings of 1000 counts per minute (cpm) or greater generally indicate the presence of elevated concentrations of  $^{226}\text{Ra}$  and/or  $^{232}\text{Th}$ . Data from the gamma profiles of the logged auger holes are graphically represented in Figs. 3 through 8. Readings at depths from 0.2 to 0.5 m were greater than 1000 cpm in auger hole 1, with a maximum reading of 4470 cpm at 0.3 m. Readings in auger hole 2 were elevated from 0.2 to 2.1 m, with a maximum of 2150 cpm at 0.5 m. No readings above 720 cpm were found in hole 3. In hole 4, elevated readings were found from

0.2 to 1.8 m, with a maximum of 18047 cpm at 1.1 m. No readings above 606 cpm were found in hole 5. Finally, elevated readings in hole 6 were found from 0.9 to 1.4 m, with a maximum of 3300 cpm at 1.2 m. Generally, the areas of highest gamma loggings correspond to the greatest concentrations of radionuclides shown in Table 3.

### SIGNIFICANCE OF FINDINGS

Measurements taken at 99 Garibaldi Avenue indicate that the property contained radioactive contamination primarily from the  $^{232}\text{Th}$  decay chain, with some contamination from  $^{226}\text{Ra}$ . These radionuclide distributions are typical of the type of material originating from the processing operations at the MCW site. The concentration and extent of  $^{232}\text{Th}$  on this property was in excess of the applicable DOE criteria (Table 1). This material was found at sample locations B1, B3, A1, A4, and A6 shown in Fig. 2. Based on the results of this radiological assessment, it is recommended that this site be considered for inclusion in the DOE remedial action program.

### REFERENCES

1. W. D. Cottrell, ORNL, to A. J. Whitman, DOE/HQ, correspondence, "Radiological Survey of Private Properties in Lodi, New Jersey" (August 15, 1984).
2. T. E. Myrick, B. A. Berven, W. D. Cottrell, W. A. Goldsmith, and F. F. Haywood, *Procedures Manual for the ORNL Radiological Survey Activities (RASA) Program*, Oak Ridge National Laboratory, ORNL/TM-8600 (April 1987).
3. U.S. Department of Energy, *Guidelines for Residual Radioactive Material at Formerly Utilized Sites, Remedial Action Program and Remote Surplus Facilities Management Program Sites* (Rev. 2, March 1987).
4. T. E. Myrick, B. A. Berven, and F. F. Haywood, *State Background Radiation Levels: Results of Measurements Taken During 1975-1979*, Oak Ridge National Laboratory, ORNL/TM-7343 (November 1981).

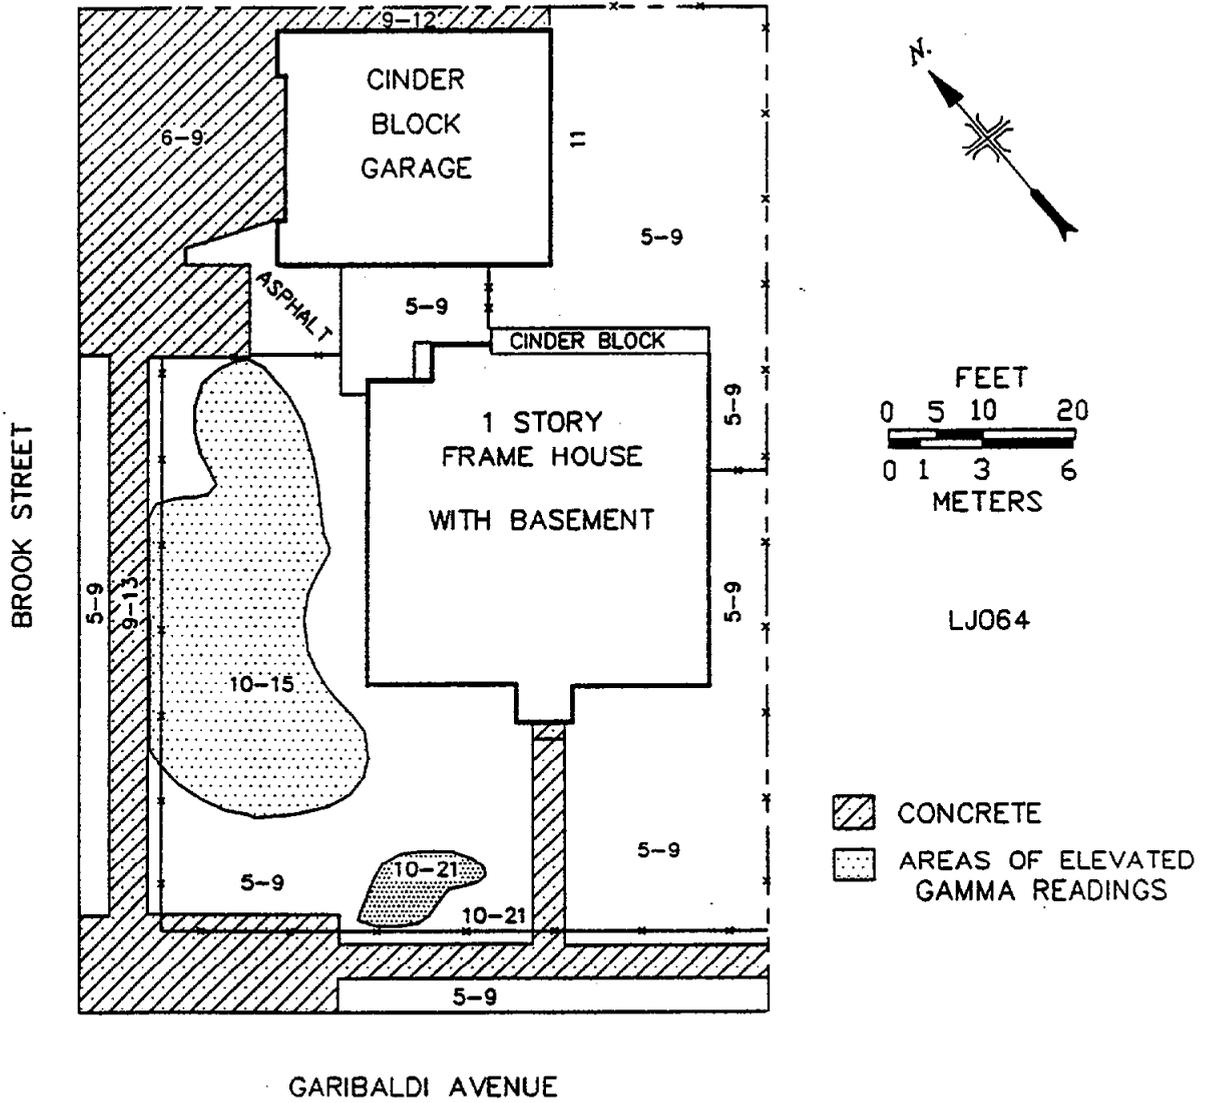


Fig. 1. Gamma radiation levels ( $\mu\text{R/h}$ ) measured on the surface at 99 Garibaldi Avenue, Lodi, New Jersey (LJ064).


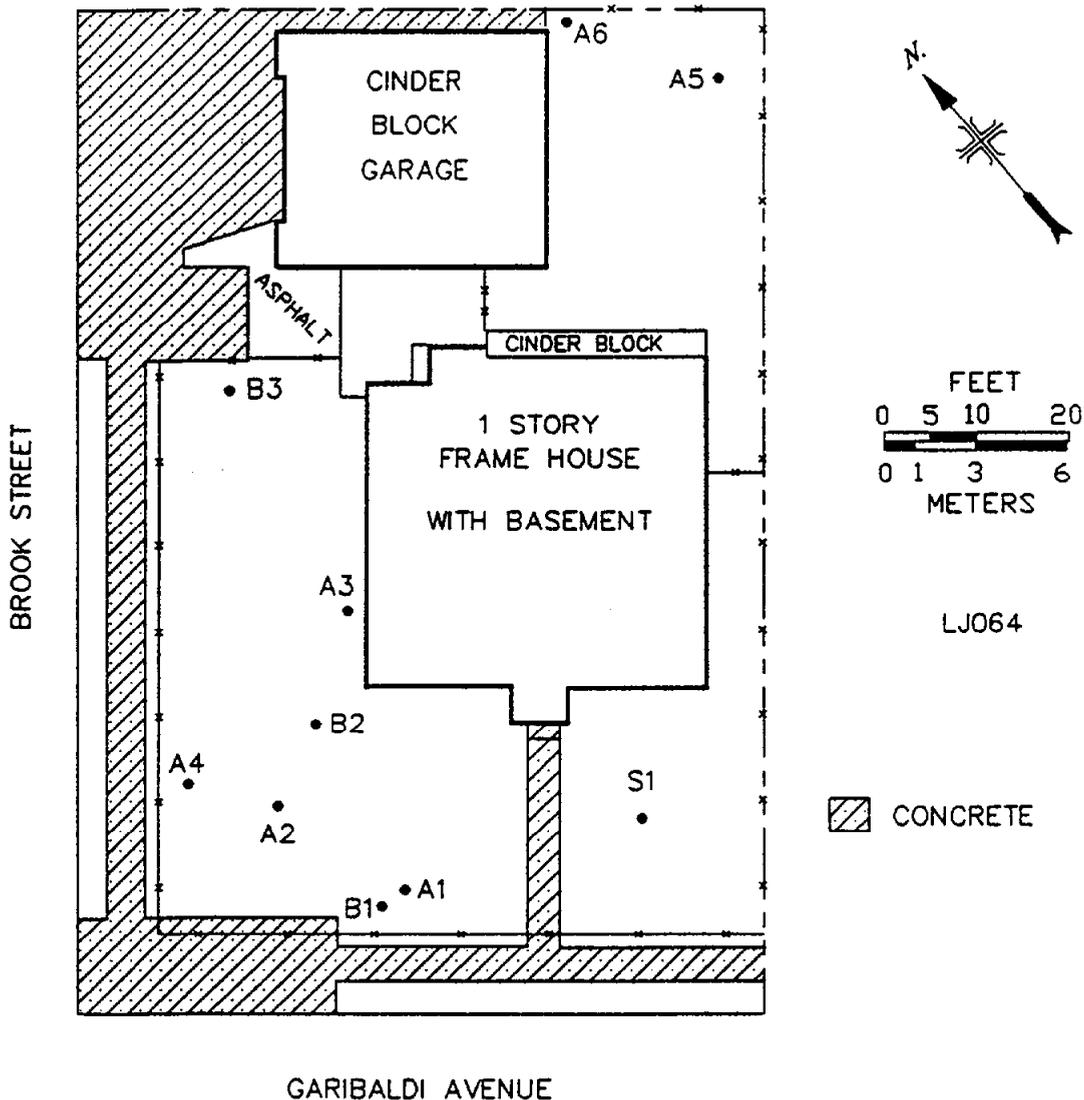


Fig. 2. Diagram showing locations of soil samples taken at 99 Garibaldi Avenue, Lodi, New Jersey (LJ064).

ORNL-DWG 89-10695

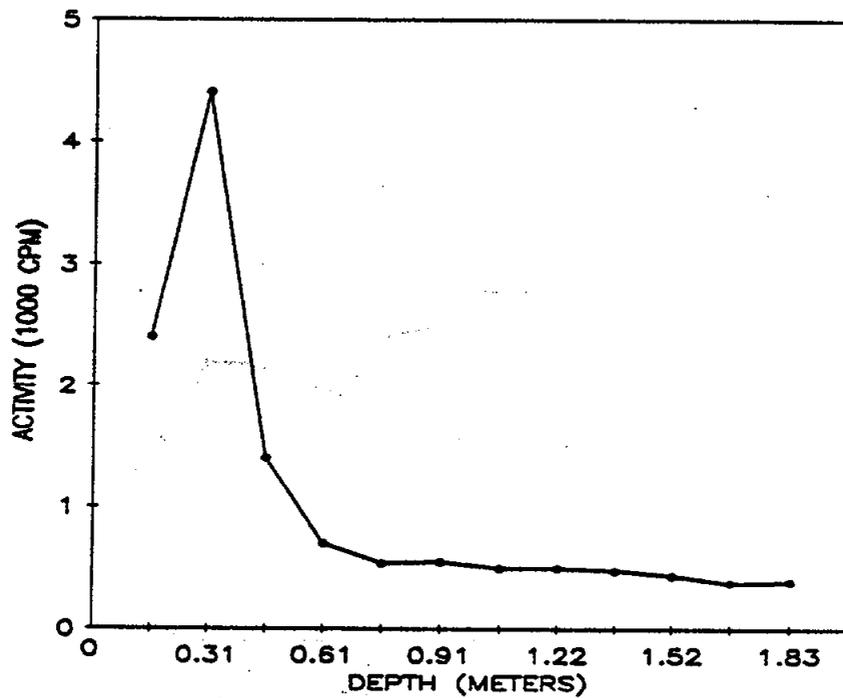

LJ064A1

Fig. 3. Gamma profile for auger hole 1 at 99 Garibaldi Avenue, Lodi, New Jersey.


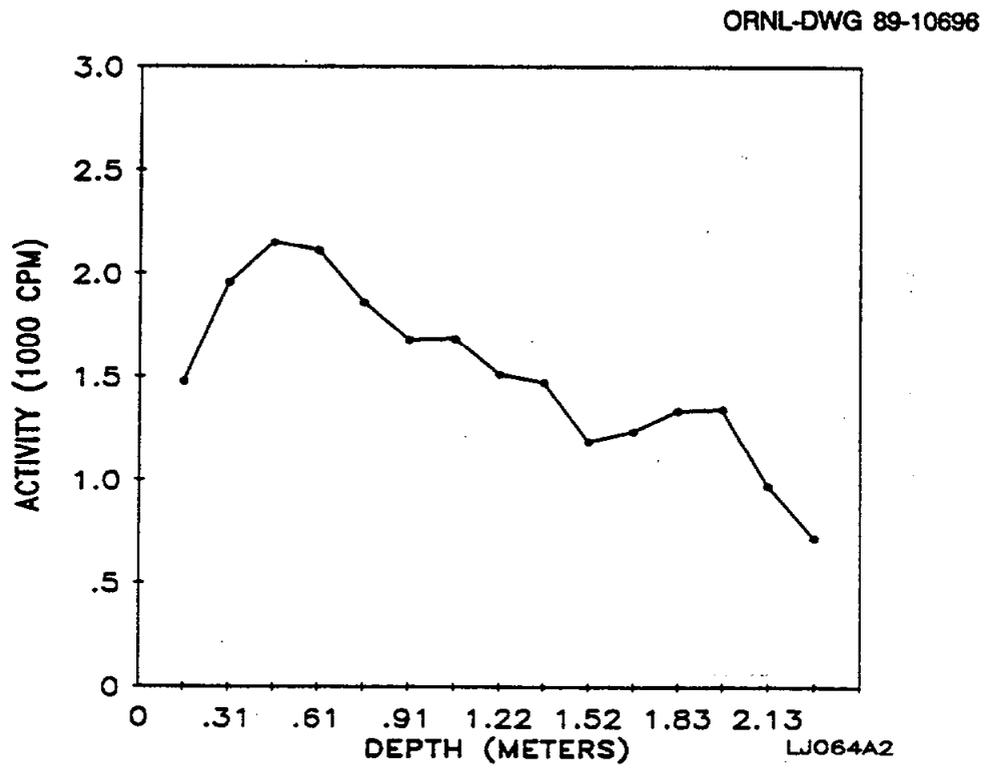


Fig. 4. Gamma profile for auger hole 2 at 99 Garibaldi Avenue, Lodi, New Jersey.


ORNL-DWG 89-10697

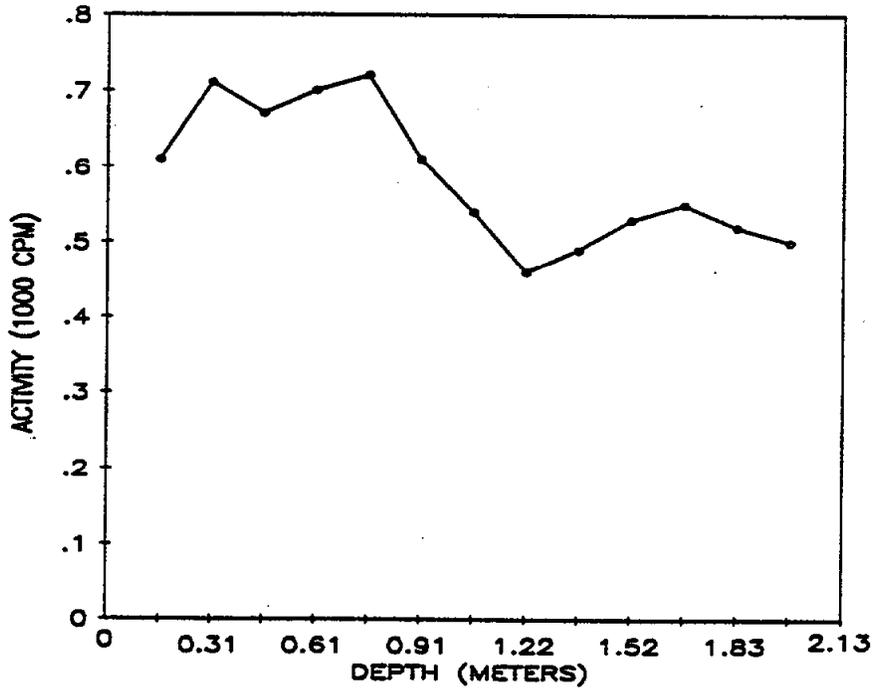

LJ064A3

Fig. 5. Gamma profile for anger hole 3 at 99 Garibaldi Avenue, Lodi, New Jersey.

ORNL-DWG 89-10698

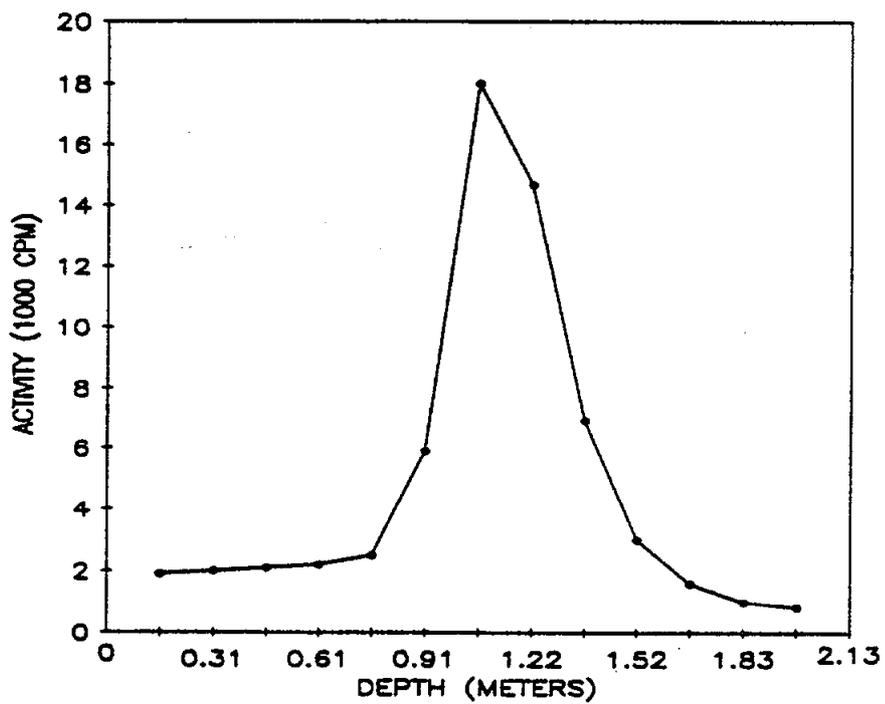

LJ064A4

Fig. 6. Gamma profile for auger hole 4 at 99 Garibaldi Avenue, Lodi, New Jersey.

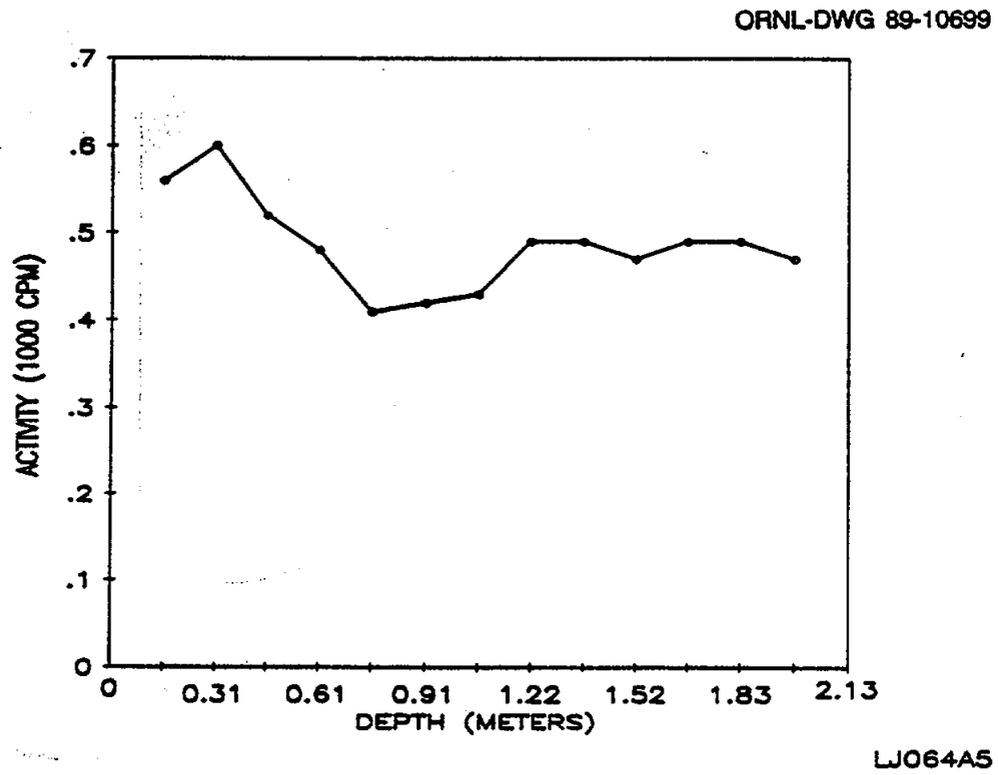


Fig. 7. Gamma profile for auger hole 5 at 99 Garibaldi Avenue, Lodi, New Jersey.

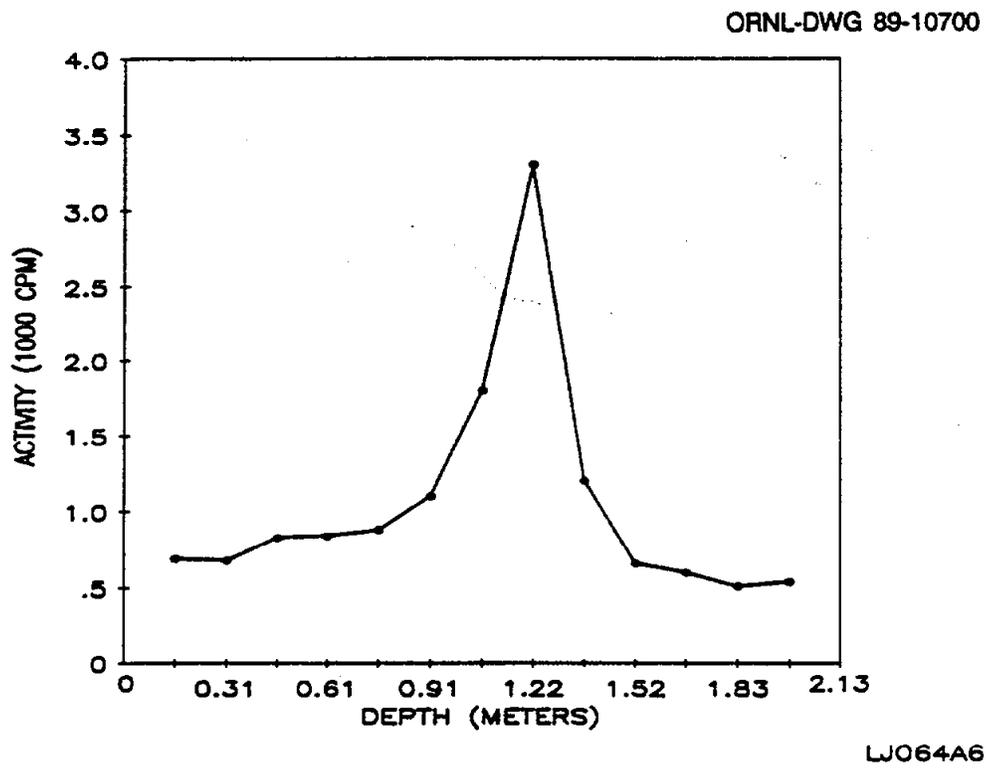


Fig. 8. Gamma profile for auger hole 6 at 99 Garibaldi Avenue, Lodi, New Jersey.

Table 1. Applicable guidelines for protection against radiation<sup>a</sup>

Mode of exposure	Exposure conditions	Guideline value
Radionuclide concentrations in soil	Maximum permissible concentration of the following radionuclides in soil above background levels averaged over 100 m <sup>2</sup> area <sup>232</sup> Th <sup>230</sup> Th <sup>228</sup> Ra <sup>226</sup> Ra	5 pCi/g averaged over the first 15 cm of soil below the surface; 15 pCi/g when averaged over 15-cm thick soil layers more than 15 cm below the surface

<sup>a</sup>Reference 3.

Table 2. Background radiation levels for the northern New Jersey area

Type of radiation measurement or sample	Radiation level or radionuclide concentration
Concentration of radionuclides in soil (pCi/g)	
<sup>232</sup> Th	0.9 <sup>a</sup>
<sup>238</sup> U	0.9 <sup>a</sup>
<sup>226</sup> Ra	0.9 <sup>a</sup>

<sup>a</sup>Reference 4.

Table 3. Concentrations of radionuclides in soil at  
99 Garibaldi Avenue, Lodi, New Jersey (LJ064)

Sample <sup>a</sup>	Depth (cm)	Radionuclide concentration (pCi/g)	
		<sup>226</sup> Ra <sup>b</sup>	<sup>232</sup> Th <sup>b</sup>
<i>Systematic samples<sup>c</sup></i>			
S1	0-15	0.71 ± 0.1	0.78 ± 0.1
<i>Biased samples<sup>d</sup></i>			
B1A	0-15	1.1 ± 0.09	7.9 ± 0.5
B1B	15-30	1.2 ± 0.3	9.8 ± 0.2
B1C	30-45	1.2 ± 0.2	9.8 ± 0.7
B2A	0-15	0.94 ± 0.1	5.4 ± 0.4
B2B	15-30	1.1 ± 0.07	6.6 ± 0.3
B2C	30-45	0.90 ± 0.1	7.4 ± 1.6
B2D	45-60	1.2 ± 0.09	8.6 ± 0.3
B3A	0-15	0.99 ± 0.5	5.2 ± 0.5
B3B	15-30	1.0 ± 0.08	6.2 ± 0.3
B3C	30-45	1.1 ± 0.1	5.7 ± 0.2
<i>Auger samples<sup>e</sup></i>			
A1A	0-15	1.2 ± 0.4	6.5 ± 0.2
A1B	15-30	2.2 ± 0.08	25 ± 0.09
A1C	30-45	1.7 ± 0.4	20 ± 1
A1D	45-60	0.41 ± 0.1	0.63 ± 0.2
A1E	60-75	0.42 ± 0.05	0.60 ± 0.04
A1F	75-90	0.37 ± 0.07	0.57 ± 0.2
A2A	0-15	0.81 ± 0.05	2.2 ± 0.2
A2B	15-30	0.90 ± 0.1	4.4 ± 0.3
A2C	30-55	1.1 ± 0.2	6.4 ± 0.3
A2D	45-60	1.1 ± 0.2	7.2 ± 0.4
A2E	60-75	1.0 ± 0.1	7.2 ± 0.4
A2F	75-90	1.1 ± 0.1	6.6 ± 0.4
A2G	90-105	1.2 ± 0.2	5.4 ± 0.4
A2H	105-120	1.0 ± 0.1	5.7 ± 0.2
A2I	120-135	1.1 ± 0.07	5.8 ± 0.3
A2J	135-150	1.1 ± 0.07	7.6 ± 0.3
A2K	150-165	0.81 ± 0.06	3.0 ± 0.06
A4A	0-15	0.79 ± 0.4	2.9 ± 0.3
A4B	15-30	0.88 ± 0.08	5.4 ± 0.6
A4C	30-45	0.79 ± 0.8	3.3 ± 0.1
A4D	45-60	0.72 ± 0.1	4.0 ± 0.3
A4E	60-75	0.59 ± 0.06	3.6 ± 0.2
A4F	75-90	0.57 ± 0.06	3.8 ± 0.2
A4G	90-105	1.1 ± 0.2	13 ± 1
A4H	105-120	6.6 ± 0.4	100 ± 6

Table 3 (continued)

Sample <sup>a</sup>	Depth (cm)	Radionuclide concentration (pCi/g)	
		<sup>226</sup> Ra <sup>b</sup>	<sup>232</sup> Th <sup>b</sup>
<i>Auger samples<sup>c</sup></i>			
A4I	120-135	4.3 ± 1	38 ± 2
A4J	135-150	2.7 ± 0.4	22 ± 2
A4K	150-165	2.0 ± 0.3	9.6 ± 0.7
A4L	165-185	1.1 ± 0.1	4.1 ± 0.2
A6A	0-15	1.0 ± 0.2	0.84 ± 0.3
A6B	15-30	0.91 ± 0.08	0.86 ± 0.09
A6C	30-45	1.0 ± 0.1	0.98 ± 0.2
A6D	45-60	1.3 ± 0.2	1.0 ± 0.3
A6E	60-75	1.3 ± 0.06	1.3 ± 0.06
A6F	75-90	0.94 ± 0.2	1.2 ± 0.1
A6G	90-105	0.81 ± 0.2	2.4 ± 0.2
A6H	105-120	3.9 ± 0.06	38 ± 1
A6I	120-135	2.4 ± 0.5	7.4 ± 0.6
A6J	135-150	1.1 ± 0.05	1.3 ± 0.1
A6K	150-165	0.94 ± 0.04	0.64 ± 0.04
A6L	165-185	0.99 ± 0.07	0.66 ± 0.04

<sup>a</sup>Locations of soil samples are shown on Fig. 2.

<sup>b</sup>Indicated counting error is at the 95% confidence level ( $\pm 2\sigma$ ).

<sup>c</sup>Systematic samples are taken at locations irrespective of gamma exposure rates.

<sup>d</sup>Biased samples are taken from areas shown to have elevated gamma exposure rates.

<sup>e</sup>Auger samples are taken from holes drilled to further define the depth and extent of radioactive material. Holes are drilled where the surface may or may not be contaminated.

## INTERNAL DISTRIBUTION

1. B. A. Berven
2. R. F. Carrier
3. W. D. Cottrell
4. A. G. Croff
5. J. W. Crutcher
6. L. M. Floyd
- 7-11. R. D. Foley
12. S. V. Kaye
13. P. Y. Lu
14. P. T. Owen
- 15-17. R. E. Swaja
18. J. K. Williams
19. Central Research Library
20. IR&A Publications Office
21. Laboratory Records - RC
22. Y-12 Technical Library

## EXTERNAL DISTRIBUTION

23. J. D. Berger, Oak Ridge Associated Universities, P.O. Box 117, Oak Ridge, TN 37831
24. R. W. Doane, Eberline, Inc., 800 Oak Ridge Turnpike, P.O. Box 350, Oak Ridge, Tn 37831
25. J. J. Fiore, U.S. Department of Energy, 19901 Germantown Road, Germantown, MD 20874
- 26-28. G. K. Hovey, Bechtel National, Inc., 800 Oak Ridge Turnpike, P.O. Box 350, Oak Ridge, TN 37831
29. L. R. Levis, Roy F. Weston, Inc., 20030 Century Blvd., Germantown, MD 20874
30. G. P. Turi, U.S. Department of Energy, 19901 Germantown Road, Germantown, MD 20874
31. J. W. Wagoner, U.S. Department of Energy, 19901 Germantown Road, Germantown, MD 20874
- 32-34. Andrew Wallo III, U.S. Department of Energy, 19901 Germantown Road, Germantown, MD 20874
35. Office of Assistant Manager, Energy Research and Development, Oak Ridge Operations Office, P.O. Box 2001, Oak Ridge, TN 37831-8600
- 36-37. Office of Scientific and Technical Information, DOE, P.O. Box 62, Oak Ridge, TN 37831